



HAL
open science

Characterization of intergranular corrosion defects in a 2024 T351 aluminium alloy

Marie-Laëtitia De Bonfils-Lahovary, Lydia Laffont, Christine Blanc

► **To cite this version:**

Marie-Laëtitia De Bonfils-Lahovary, Lydia Laffont, Christine Blanc. Characterization of intergranular corrosion defects in a 2024 T351 aluminium alloy. *Corrosion Science*, 2017, 119, pp.60-67. 10.1016/j.corsci.2017.02.020 . hal-02497140

HAL Id: hal-02497140

<https://hal.science/hal-02497140>

Submitted on 3 Mar 2020

HAL is a multi-disciplinary open access archive for the deposit and dissemination of scientific research documents, whether they are published or not. The documents may come from teaching and research institutions in France or abroad, or from public or private research centers.

L'archive ouverte pluridisciplinaire **HAL**, est destinée au dépôt et à la diffusion de documents scientifiques de niveau recherche, publiés ou non, émanant des établissements d'enseignement et de recherche français ou étrangers, des laboratoires publics ou privés.



Open Archive Toulouse Archive Ouverte (OATAO)

OATAO is an open access repository that collects the work of Toulouse researchers and makes it freely available over the web where possible

This is an author's version published in: <http://oatao.univ-toulouse.fr/25560>

Official URL: <https://doi.org/10.1016/j.corsci.2017.02.020>

To cite this version:

Bonfils-Lahovary, Marie-Laëtizia de  and Laffont, Lydia  and Blanc, Christine 
Characterization of intergranular corrosion defects in a 2024 T351 aluminium alloy.
(2017) Corrosion Science, 119. 60-67. ISSN 0010-938X

Any correspondence concerning this service should be sent
to the repository administrator: tech-oatao@listes-diff.inp-toulouse.fr

Characterization of intergranular corrosion defects in a 2024 T351 aluminium alloy

Marie-Laetitia de Bonfils-Lahovary, Lydia Laffont*, Christine Blanc

Université de Toulouse, CIRIMAT, CNRS / INPT / UPS, ENSIACET, 4 allée Emile Monso, BP 44362, 31 030 Toulouse Cedex 4, France

ARTICLE INFO

Keywords:

- A. Aluminium
- A. Copper
- A. Intermetallics
- B. TEM
- C. Intergranular corrosion

ABSTRACT

Intergranular corrosion defects formed after a 24 h immersion in a 1 M NaCl solution in a 2024-T351 Al alloy were characterized using a combination of electron microscopy techniques. Results showed the dissolution of intergranular Cu-rich precipitates all along the corroded grain boundaries. Cu species were incorporated inside the amorphous alumina oxide film identified in the corroded grain boundaries leading to the formation of structural defects in the oxide film. A 10–200 nm-thin metallic Cu-rich layer was also observed at the oxide/metal interface and at the tip of the intergranular corrosion defect.

1. Introduction

The 2024 Al alloy (AA2024) is widely used in aerospace industries due to its high strength to weight ratio, its high mechanical properties resulting from alloying elements such as copper [1,2]. However, alloying elements generate a heterogeneous microstructure leading to an increase of the susceptibility of the alloy to localized corrosion such as intergranular corrosion.

Many studies in the literature have been carried out to increase the understanding of the intergranular corrosion mechanisms in AA2024. Usually, these mechanisms are described as a galvanic coupling between intergranular Cu-rich particles (θ -Al₂Cu; S-Al₂CuMg) and the adjacent matrix [3–6]. However, some authors have shown that precipitate-free grain boundaries are also susceptible to intergranular corrosion suggesting that other parameters as grain stored energy have to be taken into account [7,8].

Nevertheless, Cu-rich particles play a predominant role in the 2XXX alloys intergranular corrosion susceptibility. The precipitation of such particles at the grain boundaries leads to a depletion of some alloying elements on both sides of the grain boundaries. Depending on the metallurgical state of the alloy, this can lead to the formation of a precipitate free zone (PFZ) surrounding the grain boundaries and increasing the susceptibility to intergranular corrosion of these alloys. The electrochemical characteristics of the

Cu-rich intermetallic phases, and mainly S-Al₂CuMg, have been widely studied [7–18]. Authors assumed a mechanism based on the strong reactivity of the particles that led to a Cu-enrichment all along the corroded grain boundaries when the alloy was exposed to an aggressive solution. Such a Cu-enrichment all along the corroded grain boundaries may have a strong effect on the progress and kinetics of the intergranular corrosion defects [7–9]. Therefore, it is of great interest to have an accurate description of the intergranular corrosion defects.

However, because of the difficulty in analyzing the grain boundary oxide films, the main part of the studies concerned Al-Cu model alloys with various Cu contents [17–33]. Authors have characterized the oxide films formed on these model alloys and identified a thick uniform layer composed of alumina with the presence of a 2–20 nm thin Cu layer at the interface oxide/Al alloy [21–25]. Garcia-Vergara et al. proposed growth models of the Cu-enriched layer with increasing thickness of the anodic film on an anodized Al-0.4 at.% Cu model alloy [20]. One of the models is based on the growth of Cu-rich clusters in the oxide film and was observed for other Al-Cu model alloys with various Cu contents [22]. Zhou et al. have also analyzed the anodic film formed on an Al-2 wt.% Cu alloy and found copper species as CuO [25].

While the nature of the oxides formed inside the intergranular corrosion defects for industrial alloys was assumed to strongly influence the intergranular corrosion propagation kinetics [7–9], it was not precisely characterized in terms of microstructure and structure due to the thickness of the oxide layer formed which required to use specific sample preparation and high resolution

* Corresponding author.

E-mail address: lydia.laffont@ensiacet.fr (L. Laffont).

analytical techniques. Comparison with the results obtained for model alloys seems relevant but this deserves to be proven due for example to the formation of a confined electrolyte inside an intergranular corrosion defect which did not exist on the plane surface of a model alloy and might affect the electrochemical processes. In the present work, the intergranular corrosion defects formed for a 2024-T351 Al alloy after a continuous immersion in a 1 M NaCl aqueous solution were characterized. Results were compared to literature data concerning the oxide layers formed on Cu-rich model alloys. A combination of Focus Ion Beam (FIB) technique, Transmission Electron Microscopy (TEM) observations, Energy Dispersive X-Ray spectroscopy (EDX) and Electron Energy Loss Spectroscopy (EELS) analyses was used to characterize accurately both the morphology and chemical composition of the intergranular corrosion defects.

2. Experimental procedure

2.1. Material

The material used for this study was a 2024-T351 Al alloy (AA2024-T351) provided by Airbus Group (France). It was received as a 50 mm thick plate formed by hot rolling and followed by solution heat treatment at 495 °C (± 5 °C), water quenching, straining and tempering in ambient conditions for 4 days to achieve the final -T351 metallurgical state. Its composition is Al base, 4.46% Cu, 1.44% Mg, 0.60% Mn and 0.13 Fe, wt.%. The microstructure of this alloy corresponds to grains highly elongated in the rolling direction (L) with the average sizes of 700, 300 and 100 μm in the longitudinal (L), long transverse (LT) and short transverse (ST) directions, respectively [34,35].

2.2. Corrosion tests

Intergranular corrosion defects were formed following a 24 h continuous immersion of AA2024-T351 in a 1 M NaCl aerated solution at room temperature (25 °C) [5,34,35]. Only the LT-ST faces of a 1 cm^3 cubic sample were exposed to the NaCl solution, the other faces being protected by a transparent lacquer, to promote the propagation of the intergranular corrosion along the L direction [36,37]. Before exposure to the NaCl solution, the sample was abraded using SiC papers down to 5 μm , then polished down to 3 μm using diamond paste with distilled water as a lubricant. The sample was finally air-dried before being prepared for TEM observations. Some polished samples ($S = 1 \text{ cm}^2$) were embedded in an epoxy resin to perform electrochemical tests. The experimental set-up consisted of a three-electrode cell, connected to a Biologic VSP apparatus, with a large platinum electrode used as counter electrode and a saturated calomel electrode (SCE) as reference electrode. The corrosion potential (E_{corr}) was measured for 24 h during exposure of the sample to the 1 M NaCl solution. For the polarization curves, the samples were first exposed to the electrolyte at E_{corr} for 1 h and then the anodic and cathodic parts were obtained independently from E_{corr} at a potential sweep rate of 0.07 mV s^{-1} .

2.3. Characterization of the intergranular corrosion defects: preparation of the samples and description of the techniques

In order to obtain a thin sample in a localized region, i.e. in an intergranular corrosion defect, the preparation was done using conventional lift out procedure using a FEI HELIOS Nanolab 600i dual beam FIB/Scanning Electron Microscope (SEM); this is summarized in the supplementary material. A transparent section was obtained. Some intermetallic precipitates were visible inside and all around the intergranular corrosion defect in agreement with literature data [5–7].

TEM and Scanning Transmission Electron Microscope (STEM) observations were recorded on a JEOL ARM 200F operating at 200 kV and equipped with a Schottky FEG, a Cs-corrector of the probe, a Gatan Imaging Filter (GIF) QUANTUM spectrometer. LAADF-STEM (Low Angle Annular Dark Field) images are dominated by diffraction contrast. In order to take into account the structure of the corrosion defects, the diffraction patterns were obtained using the Selected Area Electron Diffraction (SAED) mode or by Fourier transform of the HRTEM (High Resolution TEM) images. STEM/EELS analyses were performed with a probe size of 1 Å, an illumination semi angle of 14.8 mrd, a collection semi angle of 19.5 mrd and an energy dispersion of 0.1 eV/channel. Reference EELS spectra of CuO, Cu₂O, alpha and/or gamma and/or amorphous Al₂O₃ were recorded in the same conditions as those used for analyzing the samples.

3. Results and discussion

Fig. 1 shows a polarization curve (Fig. 1a) plotted for the AA2024 sample in 1 M NaCl solution: a sharp increase of the anodic current densities after the corrosion potential (E_{corr}) confirmed that the alloy was susceptible to localized corrosion at E_{corr} in such an electrolyte. OM observations (not shown here) of the samples after the polarization test showed both pitting and intergranular corrosion. Therefore, we chose in this study to develop intergranular corrosion defects by performing continuous immersion tests at E_{corr} . Fig. 1b shows E_{corr} versus the exposure time to 1 M NaCl solution: a continuous decrease of E_{corr} was observed in agreement with the propagation of corrosion defects. Fig. 1c shows, as an example, intergranular defects grown after a 24 h exposure at E_{corr} in 1 M NaCl. TEM observations of these intergranular corrosion defects were performed for 3 FIB samples. Depending on the sample, several intergranular corrosion defects were present and characterized. Given that the general features observed were similar for all samples, we present here only results for one intergranular corrosion defect, for brevity. Fig. 2 shows a photomontage of TEM images of an intergranular corrosion defect of an AA2024-T351 sample exposed to a 1 M NaCl solution during 24 h and removed by using a FIB/SEM.

The defect is approximately 1 μm wide and decorated by a chain of precipitates. EDX analyses allow to identify two types of precipitates: Al-Cu-Mg (80% Al – 17% Cu – 3% Mg, at.%) and Al-Cu-Mn (75% Al – 14% Cu – 11% Mn, at.%). The presence of such precipitates was in agreement with literature data concerning the metallurgy of 2XXX alloys and the intergranular corrosion mechanism which attributes the susceptibility to intergranular corrosion of 2xxx alloys to the decoration of their grain boundary network with precipitates such as S phases (Al₂CuMg) or θ phases (Al₂Cu) [3–6]. Usually, the intergranular corrosion initiation is explained by a galvanic coupling between S and θ Cu-rich phases decorating the grain boundaries and the adjacent matrix.

Observations also showed that the intergranular corrosion defect was completely filled with corrosion products which most probably corresponded to alumina. In addition, white flaws were observed inside the intergranular corrosion defect (black dashed squares in Fig. 2). They could be compared to those observed by Thompson et al. in their studies about anodization of Al-Cu model alloys, the authors describing the flaws as the results of an oxidation of Cu-rich impurities [23–26,38,39]. According to these authors, when an Al-Cu model alloy was anodized, Al was first oxidized due to the less negative Gibbs free energy per equivalent for the formation of copper oxide compared with that of alumina. This led to the formation of a few nanometers thick Cu-enriched layer at the interface alumina/model alloy inside the alloy. Inside this thin layer, Cu-rich precipitates, namely θ' phases, were formed, their size depending on the interfacial coherency between the alu-

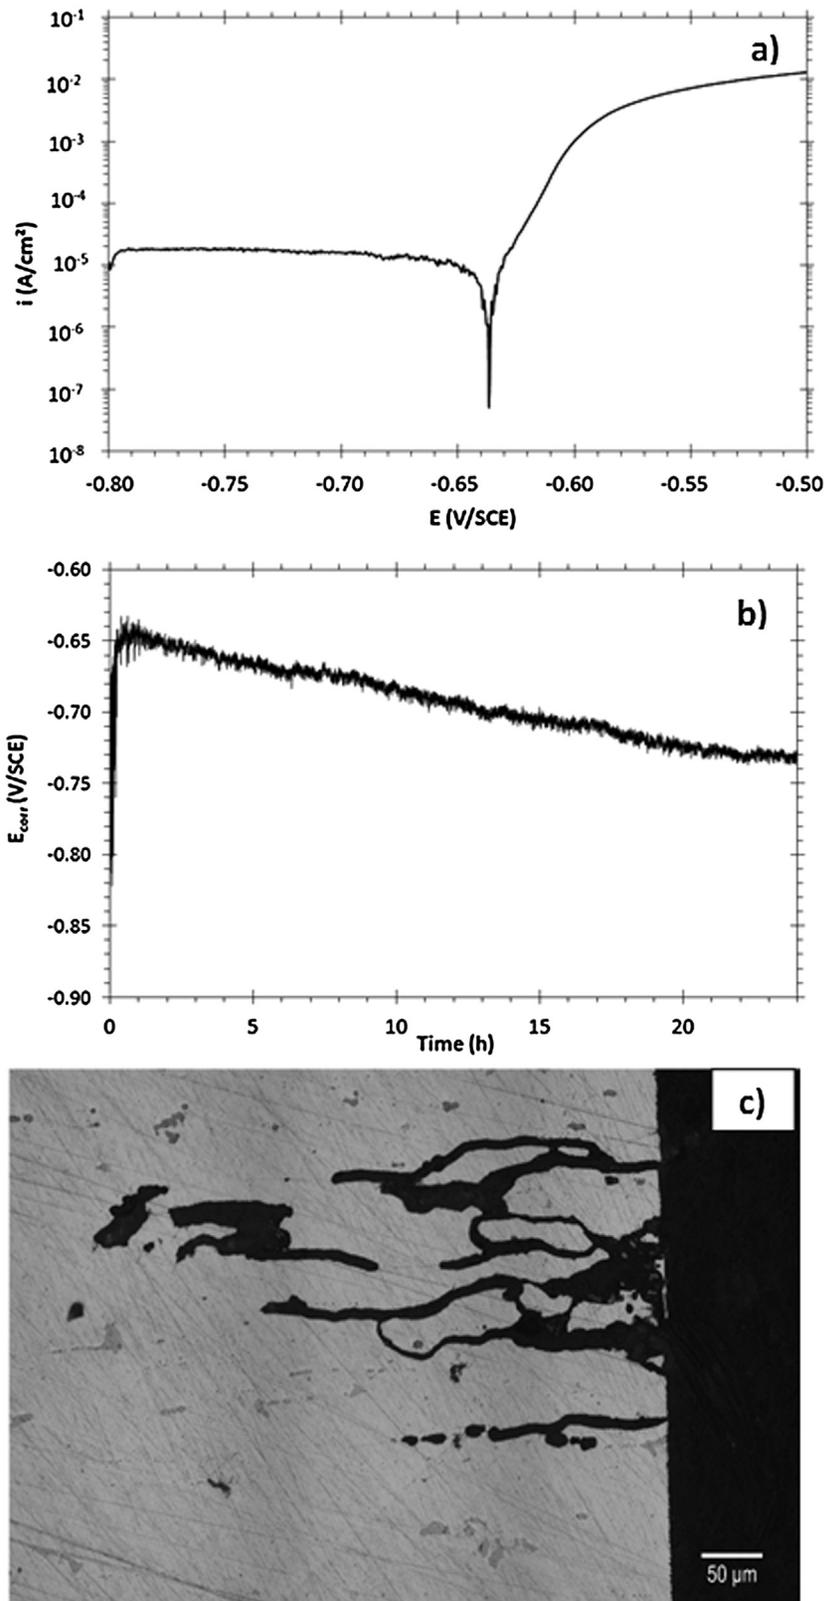


Fig. 1. a) Polarization curve of the AA2024 sample in a 1 M NaCl solution, b) E_{corr} versus the exposure time to 1 M NaCl solution, c) Optical micrograph of intergranular corrosion defects formed after a 24 h exposure at E_{corr} in a 1 M NaCl solution.

minium matrix and the Cu-rich layer [24]. Oxygen gas bubbles generated by the oxidation of Cu from these precipitates led to the formation of flaws inside the oxide film, similar to those observed in this study (black dashed squares in Fig. 2) [32]. The presence

of such flaws inside the intergranular corrosion defect formed for the industrial alloy suggested that the electrochemical processes occurring during the corrosion of the grain boundaries were similar to those observed during the anodization of an Al-Cu model

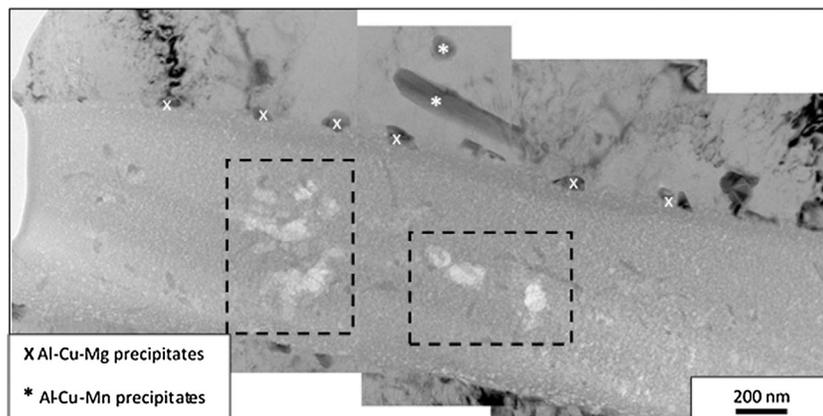


Fig. 2. Photomontage of Bright Field (BF) TEM images showing an intergranular corrosion defect in an AA2024-T351 after a 24 h immersion in a 1 M NaCl solution.

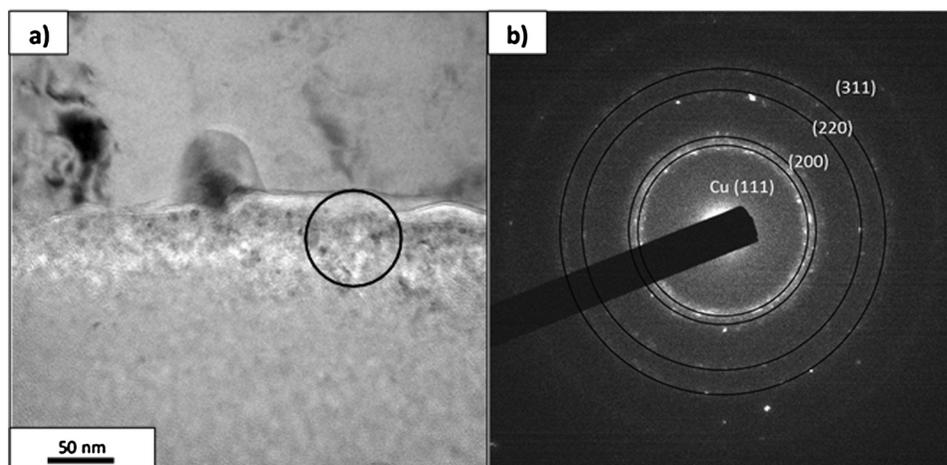


Fig. 3. a) BF TEM image showing a Cu-rich layer at the matrix-oxide interface inside the intergranular corrosion defect for an AA2024-T351 sample after a 24 h continuous immersion in a 1 M NaCl solution at room temperature. The black circle shows the area selected for the SAED pattern obtained in b).

alloy. In particular, the result suggested that, during the corrosion phenomena, a thin Cu-layer might be formed at the interface alumina, i.e. corrosion products inside the intergranular corrosion defect/alloy. Additional TEM observations showed a thin layer composed of nanoparticles of different contrast at the interface between the alloy and the oxide inside the intergranular corrosion defect, as shown in Fig. 3a: it was about 50 nm thick. Furthermore, in Fig. 3b, a SAED pattern characteristic of this layer showed diffraction circles representative of metallic nanoparticles of Cu (Fm-3m, $a = 3615 \text{ \AA}$) showing that this layer was enriched in metallic Cu species.

Further analyses were performed to complete these results and an EDX line profile was plotted perpendicularly to the alloy/oxide interface as it is shown in Fig. 4a. Fig. 4b shows the corresponding EDX profile obtained: for this analysis, the Mg signal was helpful to locate the alloy part while the oxygen signal allowed to identify the alumina film. The presence of a Cu-rich layer at the interface between the alloy and the oxide was clearly visible (Fig. 3b). In the first nanometers of the profile, the alloy composition was measured (4 at.% Cu and 2 at.% Mg); then, a Cu peak was observed with Cu content reaching a value of about 15 at.%. The Cu content rapidly decreased inside the alumina film but remained equal to 6–7 at.%. The presence of Cu species inside the alumina film was in agreement with the literature even though the Cu content was lower than that found for Al-Cu model alloys (approximately 40%) [17,21–25,30]. According to Thompson et al., the incorporation of Cu species inside the alumina film should contribute to explain the flaws observed in Fig. 2 [23–26]. Fig. 4b also showed the presence

of chloride species in the alumina film which was related to the exposure conditions certainly due to trapped electrolyte during intergranular corrosion propagation.

In order to determine precisely the chemical nature of the interfacial Cu-rich layer, EELS analyses in STEM mode were performed (Fig. 5). Fig. 5b represents the Cu-L_{2,3} edges of the interfacial nanoparticles layer compared to the Cu-L spectra of the CuO, Cu₂O and metallic Cu references [40]. Results showed that the spectroscopic signatures of Cu in this layer mainly corresponded to the EELS signature of metallic Cu. The presence of Cu₂O could not be excluded while it could be assumed that CuO was not present leading us to assume that the interfacial layer was mainly composed of metallic Cu nanoparticles [9,41].

Concerning the chemical nature of the corrosion products inside the intergranular corrosion defect, a combination of STEM and EELS techniques was also used. This enabled to probe the Al-L_{2,3} edges at the nanometer scale (Fig. 6). The fingerprint approach was also used to determine the nature of the alumina, the reference spectra of both γ , α and amorphous alumina having been obtained in the same experimental condition for comparison. The different peaks related to Al-L_{2,3} edges for γ and α -Al₂O₃ have the same shape of those described by Bouchet [42]. Moreover, the EELS spectra obtained on the corrosion defect do not fit with the Al-L edge of aluminium (oxy) hydroxide as the boehmite γ - AlO(OH), the bayerite (α - Al(OH)₃) and the gibbsite (α - Al(OH)₃) obtained by XANES [43]. Results showed that the shape of the Al-L_{2,3} edges for the corrosion product layer corresponded to those of amorphous alumina showing

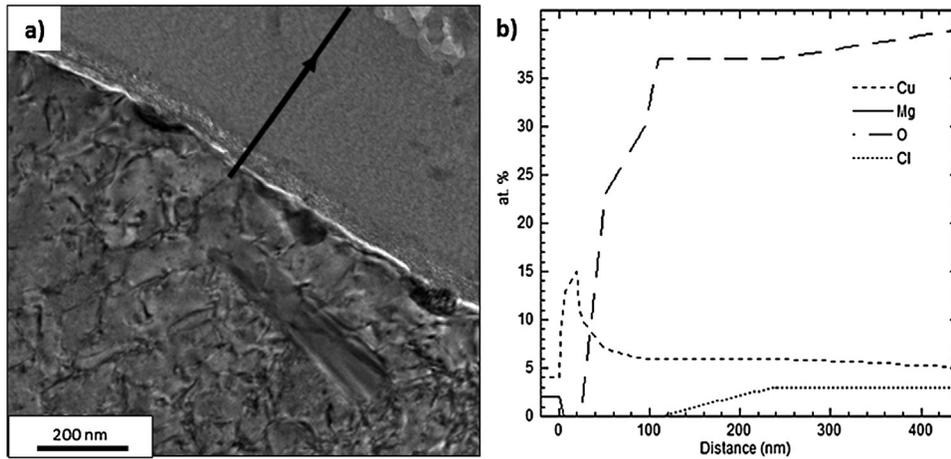


Fig. 4. LAADF STEM image (a) and EDX line profile (b) of the interface alloy/intergranular corrosion defect.

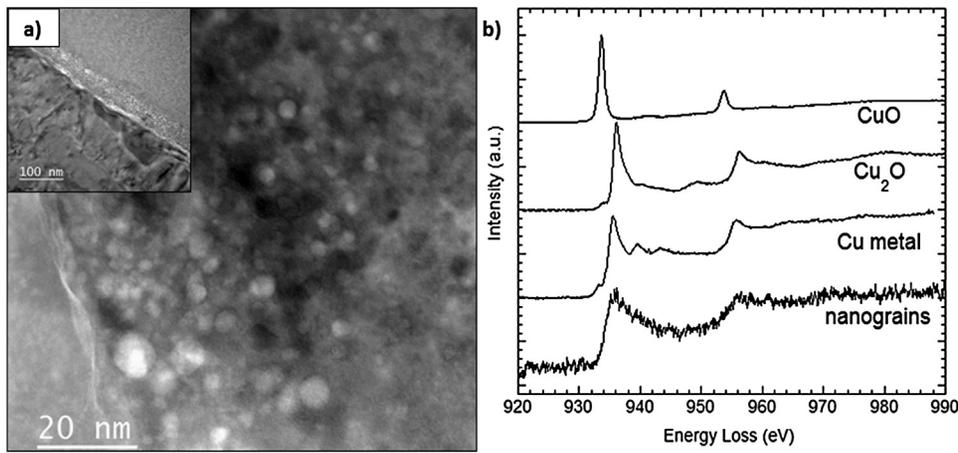


Fig. 5. a) LAADF STEM images of the interface alloy/intergranular corrosion defect showing nanoparticles combined with b) EELS analysis of the Cu-L_{2,3} edges of the nanoparticles of the interfacial layer. Copper oxide references are given for comparison.

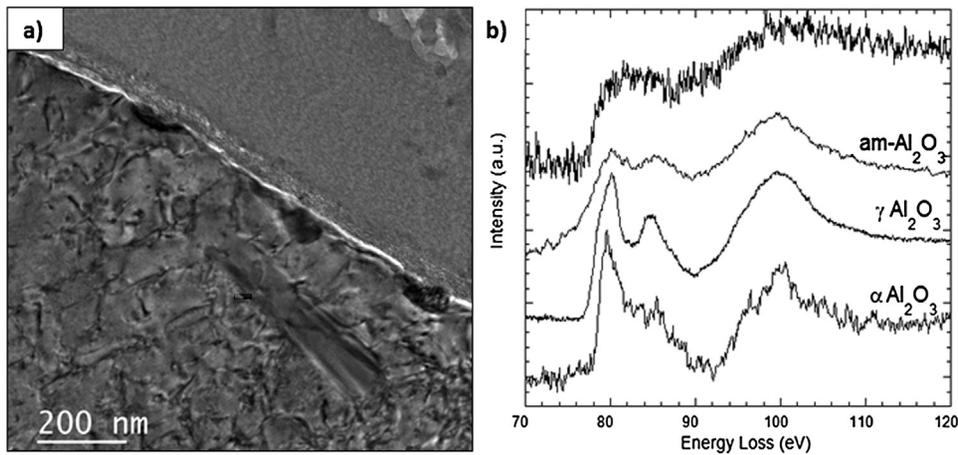


Fig. 6. a) LAADF STEM image with black spots inside the intergranular corrosion defect representing where b) EELS analysis of the Al - L_{2,3} edges was done. Spectra were compared to those of the reference α and γ alumina and amorphous alumina. For more clarity, only one spectrum corresponding to the analyzed oxide film was given.

that the intergranular corrosion defect was filled with amorphous alumina [44]. The nature of the amorphous phase is also confirmed by the lack of specific structure in HRTEM and a diffuse diffraction pattern. However, given that the sample had been dried prior to sectioning, it was likely that the amorphous alumina was a precipitate formed from either gelatinous Al corrosion products due to the

corrosion processes and/or electrolyte trapped inside the corroded grain boundaries during the drying process. This should explain the presence of Cl in the alumina film (Fig. 4b), Cl⁻ ions being trapped inside the gelatinous corrosion products/trapped electrolyte. Further, taking into account that the grain boundaries form a complex network and that intergranular corrosion is a network of attack, it

could be assumed that the gelatinous corrosion products could control the oxygen diffusion inside the corroded grain boundaries that should provide a linking path to enable the penetration of salts and oxygen into the subsurface. Therefore, the presence of Cl species should also result from migration of these species into the film. Further, even if, for long intergranular corrosion defects, it did not seem relevant to consider the oxygen reduction on the walls of the corroded grain boundaries to be the major reduction reaction, the contribution of such a cathodic reaction could not be excluded which could explain the presence of flaws (Fig. 2). Nevertheless, Al ions generated during the corrosion processes also underwent hydrolysis, forming the porous, gelatinous corrosion products that accumulated within the corroded grain boundaries. As previously said, the gel presented a barrier to diffusion, allowing local acidification [45]. This leads to the possibility that the flaws are due to hydrogen bubbles generated by H^+ reduction. Finally, concerning the chemistry of the corroded grain boundaries, Cu species were incorporated inside the amorphous alumina but, due to the Cu content lower than 10 at.%, it was difficult to identify the nature of the Cu species even though they most probably corresponded to Cu oxides, but without possibility to distinguish between CuO and Cu_2O .

Attention was also paid at the chemistry of the tip of the intergranular corrosion defect: another FIB sample was thus prepared at this specific location as represented in the photomontage of bright field image in Fig. 7a. Corrosion was developed across the grain boundary and in the neighbouring grains. Due to the 3D configura-

tion of an intergranular corrosion defect, it was difficult to ascertain that the 'tip' observed was really an active anode. Therefore, several FIB samples were prepared at locations assumed to be the tip of an intergranular corrosion defect. Results obtained were similar and only the results obtained for one 'tip' sample are shown here. As previously (Fig. 2), a chain of precipitates identified by EDX as Al_2Cu was present all along the tip of the corrosion defect which was around $1\ \mu m$ wide. A zoom on the tip (Fig. 7b) revealed the presence on a thin layer (almost 100 nm) at the interface between the alloy and the intergranular corrosion defect. A selected area diffraction pattern obtained for this layer (Fig. 7c) revealed the presence of diffraction circles representative of nanoparticles of metallic Cu (Fm-3m, $a = 3615\ \text{\AA}$). The EDX profile (Fig. 7d) confirmed the presence of the Cu-rich layer at the tip of the intergranular corrosion defect with a Cu content that can reach 90 at.%.

The results therefore showed that a Cu-rich layer was formed at the alloy/intergranular corrosion defect interface both all along the lateral sides and at the tip of the corrosion defect when AA2024 was exposed to a chloride solution. Cu species were also detected in the amorphous alumina that filled the intergranular corrosion defect. These features were similar to those observed when Al-Cu model alloys were anodized suggesting that electrochemical processes occurring in both cases, i.e. during corrosion of an industrial alloy and during anodizing of a model alloy, could be compared. Thompson et al. explained this copper enrichment as the consequence of the intergranular intermetallic particle dissolution [7] (Luo et al.). He also showed that the mechanism of Cu accumulation

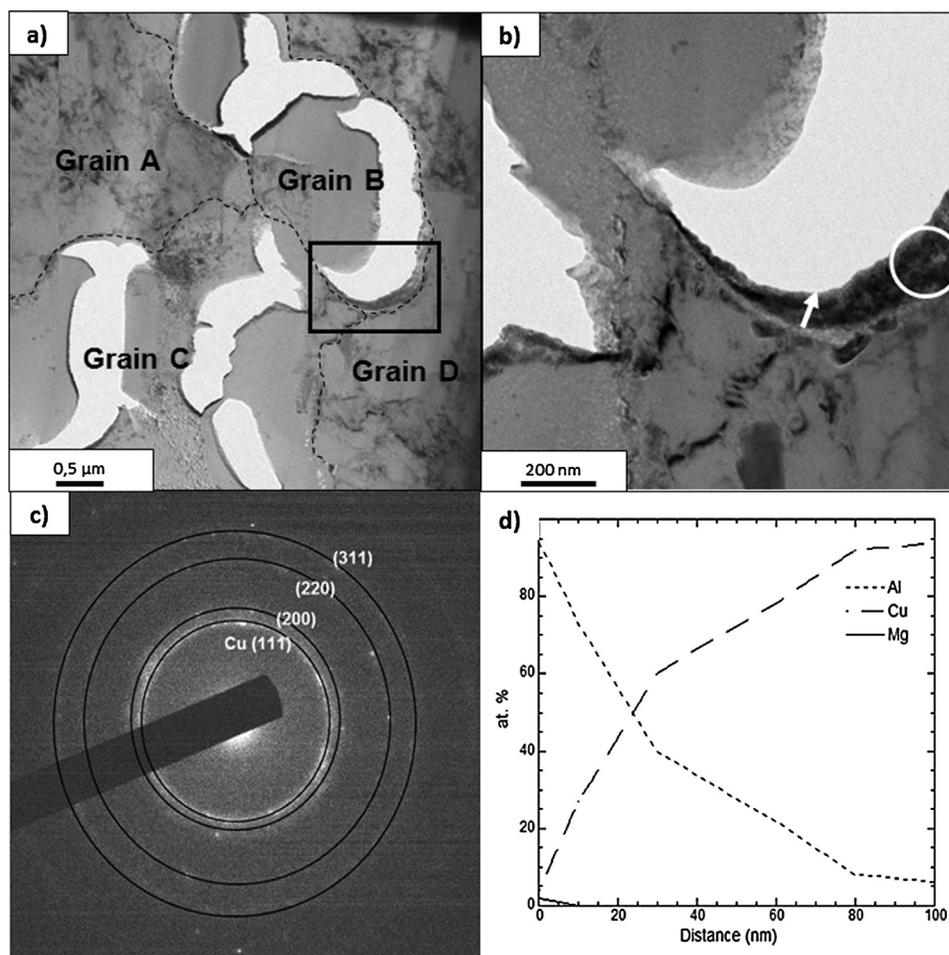


Fig. 7. a) Photomontage of bright field images of an intergranular corrosion defect with the delimited grain represented b) zoom on the tip of the corrosion defect associated with c) SAED pattern (selected area is represented by white circle in b) and d) EDX profile (line profile is represented by a white arrow in b).

at the interface between the intermetallics and the oxide was different depending on the Cu content of the intermetallics [38]. Then, he showed the formation of a Cu-rich layer on model materials for which no precipitation at the grain boundary was considered, Cu coming from the matrix dissolution [24]. Here, it could be assumed that galvanic coupling between Cu-rich intergranular particles and the adjacent matrix strongly contributed to the formation of the Cu-rich interfacial layer without excluding the contribution of Cu coming from the dissolution of the matrix. Depending on the grain boundary, different types of Cu-rich particles (with mainly Al₂Cu and Al₂CuMg) were present which could explain differences in both the Cu interfacial layer thickness and the Cu and flaws content in the amorphous alumina film. Further, as shown by Thompson et al. [38] for Al/Cu model alloys, the growth kinetics of such a Cu-enriched layer was strongly dependent on the Cu content of the Al/Cu model alloy; concerning the oxide film formed on Cu-rich intermetallics, it strongly depended on the nature of the intermetallics. Therefore, it could be assumed here that this Cu-enriched layer formed in the early stages of corrosion processes but with different rates from one grain boundary to another. However, the general features were similar from one corroded grain boundary to another. In addition to the mechanism describing the Cu-rich interfacial layer growth, the presence of this layer puts into question the corrosion mechanism and the propagation kinetics of the intergranular corrosion defect in an AA2024. Some authors [7–9] explain that the Cu-enrichment could protect the interior of the grain from further corrosive environment in AA2024. Clearly, Cu could provide effective cathodic support [9] for oxygen and/or protons reduction on the walls of the intergranular corrosion defects. So, it could be assumed that the Cu-rich layer could influence significantly the propagation kinetics of the intergranular corrosion defects by promoting the reduction of both oxygen and protons trapped inside the corrosion defects. Furthermore, the incorporation of copper species inside the amorphous alumina film that contributed to the formation of structural defects in the oxide film could also influence the propagation kinetics of intergranular corrosion defects by modifying the properties of this oxide film and thus the reactions occurring in the electrolyte trapped inside the corrosion defects [24].

4. Conclusions

1. The present work showed the formation of a 10–200 nm thin metallic Cu-nanoparticles layer at the intergranular corrosion defect/alloy interface on both sides of the corrosion defect.
2. The incorporation of copper species inside the amorphous alumina film filling the corrosion defect was highlighted and assumed to contribute to the formation of structural defects in this oxide film.
3. Furthermore, the Cu-rich interfacial layer was also observed at the tip of the intergranular corrosion defect.
4. The results raise the issue of the influence of the Cu-rich layer on the propagation kinetics of the intergranular corrosion defect.

Acknowledgement

This work is supported by ANR-14-CE07-0027-01-M-SCOT: Multi Scale Corrosion Testing.

Appendix A. Supplementary data

Supplementary data associated with this article can be found, in the online version, at <http://dx.doi.org/10.1016/j.corsci.2017.02.020>.

References

- [1] Commission on Engineering and Technical Systems, Committee on Aging of U.S. Air Force Aircraft, National Research Council, Division on Engineering and Physical Sciences and National Materials Advisory Board, Aging of U.S. Air Force Aircraft: Final Report, National Academies Press, Washington, 1997.
- [2] Success stories: air force; material substitution and new sealing, vol. 7 (2003) no. 4.
- [3] W. Zhang, G. Frankel, Transitions between pitting and intergranular corrosion in AA2024, *Electrochim. Acta* 48 (2003) 1193–1210.
- [4] J. Wloka, S. Virtanen, Detection of nanoscale η -MgZn₂ phase dissolution from an Al-Zn-Mg-Cu alloy by electrochemical microtransients, *Surf. Inter. Anal.* 40 (2008) 1219–1225.
- [5] V. Guillaumin, G. Mankowski, Localised corrosion of 2024 T351 aluminum alloy in chloride media, *Corros. Sci.* 41 (1998) 421–438.
- [6] J. Galvele, S. DeMicheli, Mechanism of intergranular corrosion of Al-Cu alloys, *Corros. Sci.* 10 (1970) 795–807.
- [7] C. Luo, X. Zhou, G. Thompson, A. Hugues, Observations of intergranular corrosion in AA2024-T351: the influence of grain stored energy, *Corros. Sci.* 61 (2012) 35–44.
- [8] X. Zhou, C. Luo, Y. Ma, T. Hashimoto, G.E. Thompson, A.E. Hugues, P. Skeldon, Grain stored energy and the propagation of intergranular corrosion in Axxx aluminium alloys, *Surf. Inter. Anal.* 45 (2013) 1543–1547.
- [9] T. Hashimoto, X. Zhang, X. Zhou, P. Skeldon, S.J. Haigh, G.E. Thompson, Investigation of dealloying of θ phase (Al₂CuMg) in AA 2024-T3 aluminium alloy using high resolution 2D and 3D electron imaging, *Corros. Sci.* 103 (2016) 157–164.
- [10] N. Birbilis, M. Cavanaugh, L. Kovarik, R. Buchheit, Nano-scale dissolution phenomena in Al-Cu-Mg alloys, *Electrochem. Commun.* 10 (2008) 32–37.
- [11] R. Buchheit, R. Boger, M. Donohue, Copper dissolution phenomena in al-Cu and Al-Cu-Mg alloys, corrosion and corrosion control in saltwater environments, *Proc. Symp. Seawater Corros.* 99 (2000) 205–212, no. PV-99-26.
- [12] R. Buchheit, The electrochemistry of θ (Al₂Cu), θ ' (Al₂CuMg) and T1 (Al₂CuLi) and localized corrosion and environment assisted cracking in high strength Al alloys, aluminium alloys: their physical and mechanical properties, Charlottesville Virginia, in: *Proceedings of the 7th International Conference ICAA7*, 331–337, 2000, p. 1641.
- [13] R. Buchheit, L. Montes, M. Martinez, J. Michael, P. Hlava, The electrochemical characteristics of bulk-synthesized Al₂CuMg, *J. Electrochem. Soc.* 146 (1999) 4424–4428.
- [14] N. Birbilis, R. Buchheit, The electrochemical characteristics of bulk synthesized Al₂CuMg, *J. Electrochem. Soc.* 152 (2005) B140–B151.
- [15] L. Lacroix, L. Ressler, C. Blanc, G. Mankowski, Statistical study of the corrosion behavior of Al₂CuMg intermetallics in AA2024-T351 by SPKFM, *J. Electrochem. Soc.* 155 (2008) C8–C15.
- [16] C. Luo, X. Zhou, G.E. Thompson, Localized dissolution initiated at single and clustered intermetallic particles during immersion of Al-Cu-Mg alloy in sodium chloride solution, *Trans. Nonferrous Met. Soc. China* 26 (2016) 2800–2809.
- [17] L. Lacroix, C. Blanc, N. Pébère, G. Thompson, B. Tribollet, V. Vivier, Simulating the galvanic coupling between θ -Al₂CuMg phase particles and the matrix of 2024 aerospace aluminium alloy, *Corros. Sci.* 64 (2012) 213–221.
- [18] L. Lacroix, L. Ressler, C. Blanc, G. Mankowski, Combination of AFM SKPFM, and SIMS to study the corrosion behavior of θ -phase particles in AA2024-T351, *J. Electrochem. Soc.* 155 (2008) C131–C137.
- [19] R. Buchheit, A compilation of corrosion potentials reported for intermetallic phases in aluminium-alloys, *J. Electrochem. Soc.* 142 (1995) 3994–3996.
- [20] S. Garcia-Vergara, P. Skeldon, G. Thompson, P. Bailey, T. Noakes, H. Habazaki, K. Shimizu, Morphology of enriched alloy layers in an anodized Al-Cu alloy, *Appl. Surf. Sci.* 205 (2003) 121–127.
- [21] Y. Liu, F. Colin, P. Skeldon, G. Thompson, X. Zhou, H. Habazaki, K. Shimizu, Enrichment factors for copper in aluminium alloys following chemical and electrochemical surface treatments, *Corros. Sci.* 45 (2003) 1539–1544.
- [22] X. Zhou, G. Thompson, H. Habazaki, K. Shimizu, P. Skeldon, G. Wood, Copper enrichment in al-Cu alloys due to electropolishing and anodic oxidation, *Thin Solid Films* 293 (1997) 327–332.
- [23] H. Habazaki, K. Shimizu, M.A. Paez, P. Skeldon, G. Thompson, G.C. Wood, X. Zhou, Oxidation of copper and mobility of copper ions during anodizing of an Al-1.5 wt.% Cu alloy, *Surf. Interface Anal.* 23 (1995) 892–898.
- [24] T. Hashimoto, X. Zhou, P. Skeldon, G. Thompson, Structure of the copper-enriched layer introduced by anodic oxidation of copper-containing aluminium alloy, *Electrochim. Acta* 179 (2015) 394–401.
- [25] X. Zhou, G. Thompson, J. Robinson, P. Skeldon, X-ray absorption spectroscopy study of the incorporated copper species in anodic alumina films formed on a Al-2 wt.% Cu alloy, *J. Electrochem. Soc.* 152 (2005) B393–B396.
- [26] K. Shimizu, K. Kobayashi, G. Thompson, P. Skeldon, G. Wood, The influence of θ' precipitates on the anodizing behaviour of binary Al-Cu alloys, *Corros. Sci.* 39 (1997) 281–284.
- [27] X. Zhou, G. Thompson, P. Skeldon, K. Shimizu, H. Habazaki, G. Wood, The valence state of copper in anodic films formed on Al-1at.% Cu alloy, *Corros. Sci.* 47 (2005) 1299–1306.
- [28] C. Blanc, A. Freulon, M. Lafont, Y. Kihn, G. Mankowski, Modelling the corrosion behaviour of Al₂CuMg coarse particles in copper-rich aluminum alloy, *Corros. Sci.* 48 (2006) 3838–3851.

- [29] J. Idrac, C. Blanc, Y. Kihn, M. Lafont, G. Mankowski, P. Skeldon, G. Thompson, Electrochemical behavior of magnetron-sputtered Al-Cu alloy films in sulfate solutions, *J. Electrochem. Soc.* 154 (2007) C286–C293.
- [30] J. Idrac, G. Mankowski, G. Thompson, P. Skeldon, Y. Kihn, C. Blanc, Galvanic corrosion of aluminum-copper model alloys, *Electrochim. Acta* 52 (2007) 7626–7633.
- [31] H. Habazaki, K. Shimizu, P. Skeldon, G. Thompson, G. Wood, Formation of amorphous anodic oxide films of controlled composition on aluminium alloys, *Thin Solid Films* 300 (1997) 131–137.
- [32] X. Zhou, G. Thompson, P. Skeldon, G. Wood, K. Shimizu, H. Habazaki, Anodic oxidation of an Al-2 wt% Cu alloy: effect of grain orientation, *Corros. Sci.* 41 (1999) 1089–1094.
- [33] A. Pakes, G. Thompson, P. Skeldon, P. Morgan, Development of porous anodic films on 2014 in tetraborate electrolyte, *Corros. Sci.* 45 (2003) 1275–1287.
- [34] C. Augustin, Prévion des cinétiques de propagation des défauts de corrosion affectant les structures en alliage d'aluminium 2024, PhD Thesis, Institut National Polytechnique de Toulouse, 2008.
- [35] C. Laignon, Mécanismes d'endommagement par corrosion et vieillissement microstructural d'éléments de structure d'aéronef en alliage d'aluminium 2024 T351, PhD Thesis, Institut National Polytechnique de Toulouse, 2011.
- [36] W. Zhang, G. Frankel, Localized corrosion growth kinetics in AA2024 alloys, *J. Electrochem. Soc.* 149 (2002) B510–B519.
- [37] W. Zhang, G. Frankel, Anisotropy of localized corrosion in AA2024-T3, *Electrochem. Solid State Lett.* 3 (2000) 268–270.
- [38] Y. Ma, X. Zhou, G.E. Thompson, M. Curioni, X. Zhong, E. Koroleva, P. Skeldon, P. Thomson, M. Fowles, Discontinuities in the porous anodic film formed on AA2099-T8 aluminium alloy, *Corros. Sci.* 53 (2011) 4141–4151.
- [39] D. Elabar, G.R. La Monica, M. Santamaria, F. Di Quarto, P. Skeldon, G.E. Thompson, Anodizing of aluminium and AA 2024-T3 alloy in chromic acid: effects of sulphate on film growth, *Surf. Coat. Technol.* 309 (2017) 480–489.
- [40] L. Laffont, M. Wu, F. Chevallier, P. Poizot, M. Morcrette, J. Tarascon, High resolution EELS of Cu–V oxides: application to batteries materials, *Micron* 37 (2006) 459–464.
- [41] S.R.K. Malladi, F.D. Tichelaar, Q. Xu, M.Y. Wu, H. Terry, J.M.C. Mol, F. Hannour, H.W. Zandbergen, Quasi in situ analytical TEM to investigate electrochemically induced microstructural changes in alloys: AA2024-T3 as an example, *Corros. Sci.* 69 (2013) 221–225.
- [42] D. Bouchet, C. Colliex, Experimental study of ELNES at grain boundaries in alumina: intergranular radiation damage effects on Al-L23 and O-K edges, *Ultramicroscopy* 96 (2003) 139–152.
- [43] R.K. Xu, Y.F. Hu, J.J. Dynes, A.Z. Zhao, R.I.R. Blyth, L.M. Kozak, P.M. Huang, Coordination nature of aluminum (oxy)hydroxides formed under the influence of low molecular weight organic acids and a soil humic acid studied by X-Ray absorption spectroscopy, *Geochim. Cosmochim. Acta* 74 (2010) 6422–6435.
- [44] P.E. Tchoupé Ngnekou, M.C. Lafont, F. Senocq, L. Laffont, B. Viguier, J. Lacaze, Structural characterization of the scale formed on a Ti-46Al-8Nb alloy oxidised in air at 700 °C, *Intermetallics* 18 (2010) 226–232.
- [45] P.C. King, I.S. Cole, P.A. Corrigan, A.E. Hughes, T.H. Muster, S. Thomas, FIB/SEM study of AA2024 corrosion under a seawater drop, part II, *Corros. Sci.* 55 (2012) 116–125.