

Crystallization damage at the interfaces of artworks

Rozeline Wijnhorst, Tinhinane Chekai, Stefano de Miranda, Leo Pel, Hannelore Derluyn, Noushine Shahidzadeh

▶ To cite this version:

Rozeline Wijnhorst, Tinhinane Chekai, Stefano de Miranda, Leo Pel, Hannelore Derluyn, et al.. Crystallization damage at the interfaces of artworks. SWBSS 2021, Fifth International Conference on Salt Weathering of Buildings and Stone Sculptures, Sep 2021, Delft, Netherlands. pp.195-197. hal-03779427

HAL Id: hal-03779427

https://hal.science/hal-03779427

Submitted on 16 Sep 2022

HAL is a multi-disciplinary open access archive for the deposit and dissemination of scientific research documents, whether they are published or not. The documents may come from teaching and research institutions in France or abroad, or from public or private research centers.

L'archive ouverte pluridisciplinaire **HAL**, est destinée au dépôt et à la diffusion de documents scientifiques de niveau recherche, publiés ou non, émanant des établissements d'enseignement et de recherche français ou étrangers, des laboratoires publics ou privés.

CRYSTALLIZATION DAMAGE AT THE INTERFACES OF ARTWORKS

Rozeline Wijnhorst¹, Tinhinane Chekai², Stefano de Miranda³, Leo Pel⁴, Hannelore Derluyn², and Noushine Shahidzadeh^{1*}

KEYWORDS

Crystallization damage, layered porous materials, ceramics, tiles, glaze defects

ABSTRACT

Over the past decades, much has been learned about the effects of salt crystallization in porous structures. In order to uncover what happens in the more complex but also more realistic situation of layered porous materials, the JPI-CH CRYSTI-NART project was initiated in the fall of 2020. This project aims to develop an integrated approach for modelling and analysis of the decay mechanism due to salt crystallization in composite materials relevant to the art conservation practice.

The objects of interest in the study at hand are antique Dutch tin-glazed tiles. These tiles consist out of two parts: the clay body (~ 0.5 cm) and the tin glaze top layer ($\sim 300~\mu m$) (Figure a & b). The body is made out of calcium-rich clay, so the thermal expansion coefficient suits the glaze during the firing of the tiles. The porosity of the body depends on the firing time and temperature [1].

Glaze defects are one of the common problems in the conservation of ceramics and tiles [2]. The defects are manifesting by (i) glaze peeling, (ii) crazing which is glaze cracking due to high surface tension and (iii) shivering which is a process that occurs when the separation between the glaze and the body induces the removal of a

Van der Waals-Zeeman Institute, Institute of Physics, University of Amsterdam, Amsterdam, The Netherlands, n.shahidzadeh@uva.nl

² Universite de Pau et des Pays de l'Adour, E2S UPPA, CNRS, LFCR - DMEX, Pau, France

Department of Civil, Chemical, Environmental, and Materials Engineering (DICAM), University of Bologna, Bologna, Italy

⁴ Eindhoven University of Technology, Department of Applied Physics, Transport in Permeable Media, Eindhoven, The Netherlands

portion from the body [2]. Earlier research on Dutch tin-glazed tiles is mostly about the manufacturing process and the chemical composition of the tiles [1]. We aim to get a better understanding of the physical properties of tin-glazed tiles and their effect on salt weathering of these tiles.

Tin-glaze is a white and shiny glass. The glaze itself is in principle non-porous, but air and gas bubbles can be formed during the firing of the tile in the manufacturing process (black square in Figure 1a and b) [1]. Some tiles have a dense pattern of cracks visible in the glaze surface which is called craquelure (red square in Figure 1a-b). We performed our experiments on 2 x 2 cm samples cut out of antique tiles provided by the company Regts antieke tegels (Figure c). One tile, dating from the end of the 19th century, had no craquelure and has a measured porosity of around 25% (mass percentage). The other tile did have craquelure, was made in between the second half of the 18th century and the second half of the 19th century, and has a measured porosity of around 30%. Both glaze layers are partially wetting and hydrophilic as the contact angle of pure water on the glaze is ~30°. From the SEM images and the X-ray scans, we observed that the craquelure is only present in the glaze layer and not in the clay body of the tile. Although the glaze itself should be non-porous, the craquelure can form a connection between the air and gas bubbles in the glaze layer and can create open porosity (Figure 1a and b). Still, the drying kinetics of the sample with craquelure and without craquelure are similar as the craquelure is small compared to the open sides of the tiles (Figure 1c).

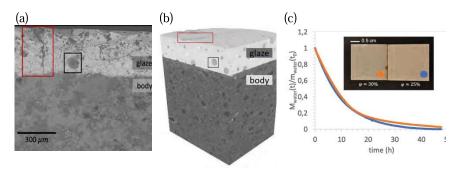


Figure 1: SEM image (a) and 3D X-ray CT reconstruction (b) of the glaze-body interface. An example of craquelure is marked in the red square and an example of an air bubble within the glaze in the black square. (c): Drying kinetics of 2×2 cm samples of a tile with craquelure (orange curve) and without craquelure (blue curve).

In the next step of this study, salt weathering cycles will be imposed on tile samples with and without craquelure to assess how salt damage is affected by the extra air inlet of the craquelure. In addition, we will investigate how the salt crystallization itself can cause cracks and craquelure.

REFERENCES

- [1] K. van Lookeren Campagne et al., "Understanding 17th-18th century Dutch Tin-glaze Through the Interpretation and Reconstruction of Historical Recipes." *GlazeArt*, pp 150-164, 2018.
- [2] B.H. Wilson, "Monograph and bibliography on terra cotta". *Journal of the American Ceramic Society*, pp 94–136, 1926.