



Comparison of Dynamic Cobble Berm Revetments with Differing Cobble Characteristics

Ollie Foss, Chris Blenkinsopp, Paul Bayle, Kévin Martins, Stefan Schimmels,
Luis Pedro Almeida

► To cite this version:

Ollie Foss, Chris Blenkinsopp, Paul Bayle, Kévin Martins, Stefan Schimmels, et al.. Comparison of Dynamic Cobble Berm Revetments with Differing Cobble Characteristics. Coastal Engineering, 2023, 183, pp.104312. 10.1016/j.coastaleng.2023.104312 . hal-04271886

HAL Id: hal-04271886

<https://hal.science/hal-04271886>

Submitted on 6 Nov 2023

HAL is a multi-disciplinary open access archive for the deposit and dissemination of scientific research documents, whether they are published or not. The documents may come from teaching and research institutions in France or abroad, or from public or private research centers.

L'archive ouverte pluridisciplinaire **HAL**, est destinée au dépôt et à la diffusion de documents scientifiques de niveau recherche, publiés ou non, émanant des établissements d'enseignement et de recherche français ou étrangers, des laboratoires publics ou privés.

Comparison of Dynamic Cobble Berm Revetments with Differing Cobble Characteristics

Ollie Foss¹, Chris E. Blenkinsopp¹, Paul M Bayle^{1,2}, K vin Martins³, Stefan Schimmels⁴, and Luis Pedro Almeida^{5,6}

¹*Water Environment and Infrastructure Resilience Research Unit, Department of Architecture and Civil Engineering, University of Bath, Bath, BA2 7AY, United Kingdom*

²*Faculty of Civil Engineering and Geosciences, Delft University of Technology, Delft, 2628 CD, The Netherlands*

³*UMR 5805 EPOC, CNRS - University of Bordeaux, All e Geoffroy Saint-Hilaire, F-33615, Pessac, France*

⁴*Forschungszentrum K ste (FZK), Leibniz University Hannover & Technische Universit t Braunschweig, Merkurstra e 11, 30419, Hannover, Germany*

⁵*Universidade Federal do Rio Grande (FURG), Campus Carreiros, Instituto de Oceanografia, Avenida Italia, Km 8 96203-900, Rio Grande, RS, Brazil*

⁶*+ATLANTIC LVT, Edif cio LACS Estrada da Malveira da Serra 920, 2750-834, Cascais, Portugal*

Keywords— Dynamic Cobble Berm Revetment, Dynamic Revetment, Coastal Adaptation, Nature Based Solutions, Cobble Characteristics, DynaRev

Abstract

Pressure on the coastline is escalating, this is leading to a rise in sea-levels and intensifying storminess. Consequently, many regions of the coast are at increased risk of erosion and flooding. In response there is a growing use of nature-based coastal protection which aim to be sustainable, effective and adaptable. An example of a nature-based solution is a dynamic cobble berm revetment: a cobble berm constructed at the high tide wave runup limit. These structures limit wave excursion protecting the hinterland from inundation, stabilise the upper beach and adapt to changes in water level. Recent experiments and field applications have shown the suitability of these structures for coastal protection, however many of the processes and design considerations are poorly understood. This study directly compares two prototype scale laboratory experiments which tested dynamic cobble berm revetments constructed with approximately the same geometry but differing cobble characteristics; well-sorted rounded cobbles (DynaRev1) and poorly-sorted angular cobbles (DynaRev2). In both cases the structures were tested using identical wave forcing including incrementally increasing water level and erosive wave conditions. The results presented in this paper demonstrate that both designs responded to changing water level and wave conditions by approaching a dynamically stable state, where individual cobbles are mobilised under wave action but the geometry remains approximately constant. Further, both structures acted to reduce swash excursions compared to a pure sand beach. However, their morphological behaviour in response to wave action varied considerably. Once overtopping of the designed crest occurred, the poorly-sorted revetment developed a peaked crest which grew in elevation as the water level or wave height increased, further limited overtopping. By comparison, the well-sorted revetment was characterised by a larger volume of submerged cobbles and a lower elevation flat crest

which responded less well to changes in conditions. This occurred due to two processes: (1) for the poorly-sorted case, cobble sorting processes moved small to medium cobble material ($D_{50} < 70mm$) to the crest and (2) the angular nature of the poorly-sorted cobble material promoted increased interlocking. Both of these processes led to a cobble matrix that is more resistant to wave action and gravitational effects. Both revetments experienced some sinking due to sand erosion beneath the front slope. The rate of sinking for the well-sorted case was larger and continued throughout due to the large pore spaces within the cobble matrix. For the poorly sorted revetment in DynaRev2, sand erosion ceased after approximately 28 h due to the development of a filter layer of small gravel at the sand-cobble interface, hence a larger volume of sand was preserved beneath the structure. Both designs present a low-cost and effective solution for protecting sandy coastlines but from an engineering viewpoint it appears better to avoid well-sorted cobble material and greater cobble angularity has been seen to increase crest stability.

1 Introduction

Globally, anthropogenic pressure on the coastline is escalating, leading to an increased threat from sea-level rise (SLR) as well as increasing severity and frequency of storms (DeConto and Pollard (2016)). It is estimated if current coastal defences are not upgraded, global flood losses could exceed US\$1 trillion per year by 2050 (Hallegatte et al. (2013)). Therefore new coastal management strategies and structures are required to mitigate the increased coastal hazards. Often it is preferable to do this at a local level, taking into account the ecological, environmental and economic concerns of the region. Dynamic cobble berm revetments which mimic naturally occurring composite beaches are a promising coastal intervention to reduce erosion of the beach face and inundation of the hinterland. The structure can be comprised of low-cost material such as quarry spall and requires no specialist equipment to install, making it well-suited to a localised approach to coastal protection. Such a solution may be particularly appropriate in areas where composite beaches naturally occur as the structure can be designed based on these beaches, leading to a defence that is in-fitting with the local environment, potentially using locally sourced materials.



Figure 1: Left) The poorly-sorted revetment. Right) The well-sorted revetment

Traditional coastal protection techniques can be divided into two broad groups (Cartwright et al. (2008)). The first is hard engineering solutions often referred to as grey structures (Morris et al. (2018)), these consist of fixed structures such as seawalls and artificial reefs. They are designed to provide a fixed barrier and are typically expensive to install

(Howe and Cox (2018a,b)). Additionally, many existing hard engineering schemes were not designed for the current and predicted wave climates and therefore require upgrading or replacing. For example, it is common for sea walls to have a fixed crest height which was designed without consideration of sea level rise. Increasing the elevation of these structures risks failure due to the capacity of the foundations to bear additional load.

The second group are soft engineering solutions such as beach, dune or submerged nourishment (Kana et al. (2018)). As the drivers of coastal erosion are site specific, the lifespan of such schemes are unpredictable although these can often be re-implemented as required (Cartwright et al. (2008); French (2001); Ludka et al. (2018)). Additionally, many regions have strict environmental laws that make sourcing of appropriate sediment difficult (Pranzini (2018)). Further, such schemes are often ecologically destructive (Seymour et al. (1996)), in the case of dune nourishment this problem is further exacerbated by the complex nature of ecosystem diversity in dune systems (Cooper and Jackson (2021)). An alternative is nature based solutions that focus on the restoration of natural habitats such as salt marshes and mangroves (Morris et al. (2018)), but the long term effectiveness of such schemes has not been established and they are not appropriate for high energy coastlines. A more extreme option is managed retreat (Hino et al. (2017)), where the coastline is left to develop naturally. However, this has socio-political difficulties due to impact on local communities.

Most shoreline protection schemes utilise hard engineering, soft engineering, managed retreat or a combination of these dependent on environmental and community pressures. As the impact of climate change becomes progressively worse these schemes will increase in cost. There is an urgent need for new coastal protection methods and structures to deal with future environmental demands.

Composite Beaches are identified by Jennings and Schulmeister (Jennings and Schulmeister (2002)) as a beach type with bi-modal sediment composition, sand and gravel, separated into two distinct zones. The foreshore of the beach is composed of sand and the backshore ridge, normally located at the high tide shoreline, is composed of gravel. The combination of dissipative sand foreshore and reflective cobble ridge is considered an effective natural form of coastal protection (Allan and Gabel (2016)), providing stability to the upper beach and protecting the hinterland from overtopping. The cobble ridge reshapes in response to wave attack, maintaining the ridge's elevation relative to the water level with minimal loss of gravel material. During this process, gravel sediments move constantly under wave forcing but the ridge responds as a single coherent body, this is referred to as dynamic stability in this paper. The cobble ridge is most commonly exposed to swash processes during energetic wave conditions and spring high tides leading to infrequent overtopping of the ridge (Everts et al. (2002); Allan and Komar (2004)). At present, composite beaches are under represented in the academic literature and there is a lack of numerical, laboratory and field studies investigating their behaviour. Recent research from Matsumoto (Matsumoto and Young (2018); Matsumoto et al. (2020a,b)) has investigated seasonal behaviour of composite beaches in Southern California and an early review is provided by Mason et al. (Mason and Coates (2001)).

In engineering terms dynamic cobble berm revetments are artificially constructed berms of gravel sediments, placed at or near the high tide berm of a sandy beach. A review of these structures is provided by Bayle et al. (2020) and surmised here. They are designed to mimic naturally occurring composite beaches, providing erosion control, stability for the upper beach and protection to the hinterland. Due to this they are considered a nature based solution for coastal protection. The DynaRev1 large-scale laboratory experiment (Bayle et al. (2020)) compared the resilience and morphological response of a dynamic cobble berm revetment constructed using well-sorted, rounded

cobbles to that of a sand beach under both wave forcing and increasing water level. [Bayle et al. \(2020\)](#) found that installation of a dynamic cobble berm revetment led to reduced erosion and inundation of the upper beach. Furthermore, the experiment demonstrated the dynamic stability of such structures, which allowed them to adjust to changing wave conditions and water-level rise while maintaining a coastal defence function with minimal cross-shore loss of gravel, similar to composite beach ridges. This suggests that they have the potential to be a climate adaptive coastal intervention. Field applications are rare with only a few small scale or trial structures installed, primarily in North America. The most recent and directly comparable dynamic cobble berm revetment design is that installed at North Cove, Washington in 2018 ([Weiner et al. \(2019\)](#)). The coastline at this location had been suffering rapid erosion since records were started in 1871 ([Phipps and Smith \(1978\)](#)), with a shoreline retreat of approximately 4 km over the historical record, leading to the moniker Washaway Beach. A 2 km stretch of the coastline was protected using a dynamic cobble berm revetment constructed between February 2017 and January 2019 using poorly-sorted quarry spall. The monitoring report over the first set of winter storms states that the uplands were protected from significant erosion ([Weiner et al. \(2019\)](#)). Further, although sand was eroded from the lower beach face over the winter, the sand volume at the site had rebounded by March due to deposition at the toe. A recent field experiment conducted over a spring tidal cycle with high energy waves (H_s up to 6 m) observed that the revetment underwent large fluctuations in both elevation and volume due to the combined behaviour of the gravel berm and underlying sand. However, over an entire spring tidal cycle overall change in volume was small ([Bayle et al. \(2021\)](#)) and the structure displayed a dynamic stability comparable to a composite beach.

At present, dynamic cobble berm revetments designed using non-sorted gravels are effective at protecting their respective coasts. This current study examines the differences in morphological response of revetments designed using differing cobble populations. It is then contextualised in consideration of coastal protection techniques. It follows that published by Bayle et al. [Bayle et al. \(2020\)](#) which reported on the ‘DynaRev’ experimental investigation of a dynamic cobble berm revetment constructed using well-sorted, rounded cobbles (hereafter called DynaRev1). This work presents a comparable large-scale experiment (DynaRev2), designed similar to the DynaRev1 experiment to investigate the performance of a different dynamic cobble berm revetment under the same conditions. It was constructed with approximately the same geometry as the original revetment, but comprised of poorly-sorted, angular material equivalent to quarry run that would be expected to be widely available throughout the developed and developing world. This work compares the results from both experiments (see [Figure 1](#) for comparative photo of the two revetment structures).

The paper is structured as follows: This section provides a background and shortened overview of the existing studies pertaining to dynamic cobble berm revetments. [Section 2](#) details the methodology of the prototype-scale flume testing of the structure constructed using poorly-sorted angular material. [Section 3](#) presents a thorough comparison of the morphodynamic response of the structures under testing and investigates their potential as coastal defence. [Section 4](#) discusses the results in the wider context of coastal protection and highlights the limitations of the structures. [Section 5](#) presents a conclusion for the study.

2 Methodology

2.1 Experimental Facility

The DynaRev2 experiment was designed to repeat DynaRev1 (discussed in Section 2), but with a revetment constructed using poorly-sorted angular cobbles instead of well-sorted rounded material. DynaRev2 was completed in the same facility as DynaRev1, the Großer Wellenkanal large wave flume (GWK) located in Hanover during November and December 2019. The flume is 309 m long, 7 m deep and 5 m wide and utilises a combined piston-flap-type wave paddle with automatic reflection compensation (ARC).

The revetment was constructed on a 1:15 sandy beach. The sand used during the experiment was the same as that for DynaRev1 and had the following grain size characteristics; $D_{50} = 0.33$ mm, $D_{10} = 0.20$ mm and $D_{90} = 0.65$ mm. The total volume of sand used for the beach construction was 875 m³. The entire beach profile including the revetment was constructed 11 m further from the wave paddle than in DynaRev1 and is shown in Figure 2b. This shift is not expected to influence the results as it simply increased the length of the deepwater section of the flume. To aid comparison between the two experiments, an adjusted 2-dimensional co-ordinate system was defined for DynaRev2, with the cross-shore origin located in front of the wave paddle such that the wave paddle is located at $x = -11$ m and continues in the positive direction towards the beach. The vertical elevation from the base of the flume defines the z -direction such that 0 m represents the floor of the flume as shown in Figure 2.

2.2 Experimental Procedure

The experiment was split into a series of twelve ‘tests’, where a test represents a change in conditions, such as water level increase (see Table 1 for full details). Each test was split into a series of runs with varying length after which the waves were stopped and the beach profile measured using a mechanical profiler described in Section 2.3.1. After each run neither the beach or revetment were reset giving each test a unique antecedent morphology. Note that the DynaRev2 runs do not align with those for the DynaRev1 experiment, however the experimental conditions and total experiment time for each test are identical. Here we avoid using run names and instead reference the experimental time from revetment installation.

To ensure the revetment was installed on a “realistic” beach profile, the planar beach slope detailed in subsection 2.1 was allowed to evolve naturally under 20 hours of wave forcing ($H_s = 0.8$ m, $T_p = 6.0$ s) with a constant water level ($z_{wl} = 4.5$ m). Upon this developed profile the poorly-sorted revetment was installed such that the crest elevation corresponded to the predicted value of $R_{2\%}$ for a water level of $z_{wl} = 4.8$ m (Table 1; for further details on the revetment geometry see subsection 2.3). After revetment installation, a series of four long tests were completed using the standard wave conditions with a 0.1 m incremental water level increase for each test from $z_{wl} = 4.6$ m to $z_{wl} = 4.9$ m. The tests are named using the following notation 2DR(E,R)<WL increment> where a WL increment of 0 refers to $z_{wl} = 4.5$ m and increases by 1 for each subsequent 0.1 m water level rise. For example, the Test 2DR3 refers to the fourth test with water level $z_{wl} = 4.8$ m, this would have identical testing conditions to the Test DR3 from the DynaRev1 experiment.

Following the water level rise testing a series of ‘resilience tests’ were completed, during which the wave energy was increased and the water level remained constant ($z_{wl} = 4.9$ m). This was then followed by a final test which used the standard irregular wave conditions to encourage recovery of the structure. The tests had varying duration’s and are denoted

Table 1: The testing conditions for DynaRev2. H_s is the significant wave height, T_p is the peak wave period, Ω_0 is the dimensionless fall velocity as given by Dean (1973); Gourlay (1968) and wave energy is given per metre of wave crest.

Test	Start (hr)	End (hr)	Duration (hr)	H_s (m)	T_p (s)	Water Level z_{wl} (m)	Ω_0	Energy (MJ)
Beach Equilibrium Approach								
2DR0	-20:00	0:00	20	0.8	6	4.5	3.38	0.78
Revetment Construction								
2DR1	0:00	7:00	7	0.8	6	4.6	3.38	0.78
2DR2	7:00	14:00	7	0.8	6	4.7	3.38	0.78
2DR3	14:00	21:00	7	0.8	6	4.8	3.38	0.78
2DR4	21:00	38:00	17	0.8	6	4.9	3.38	0.78
Resilience Tests								
2DRE1	38:00	40:00	2	0.9	6	4.9	3.69	0.99
2DRE2	40:00	42:00	2	1	7	4.9	3.51	1.23
2DRE3	42:00	43:00	1	1	8	4.9	3.08	1.23
2DRR1	43:00	45:00	2	0.8	6	4.9	3.38	0.78
Re-nourishment Tests								
2DRN1	45	47	2	0.8	6	4.9	3.38	0.78
2DRN2	47	47.40	0.66	1	9	4.9	2.73	1.23
2DRN3	47.40	49.40	2	0.8	6	4.9	3.38	0.78

using the naming convention 2DR(E , R)<test number> where E and R refer to erosive and recovery tests respectively.

The ‘Re-nourishment Tests’ examined the process of recharging the revetment, see Table 1. An additional 1.5 m³ of cobbles were placed on the front face of the revetment. This was forced using a mixture of both the standard irregular wave conditions and a shortened high energy wave test (Table 1). These are denoted using the naming convention DRN<test number>. Due to restricted experimental time this was a shortened process and is not considered directly comparable to the DynaRev experiment.

2.3 Revetment Installation and Characteristics

The poorly-sorted revetment used in DynaRev2 was designed with the same geometry as the well-sorted revetment from DynaRev1. Prior to installation, the revetment location was flattened to a 1:15 slope to allow sufficient cobble placement at the design slope of 1:6.3 (this was also done for the well-sorted case). Construction was carried out using a front end loader to dump the cobbles at the approximate location and then manually reshaped to match the profile of the well-sorted revetment. Due to difficulties in shaping angular cobbles, the profile of the revetment differed slightly to that in DynaRev1, with a less well-defined crest (Figure 2 b). The revetment was constructed using poorly-sorted granite cobbles with density 2700 kg/m³, bulk density 1760 kg/m³ and a porosity of 0.35. The intermediate axis characteristics were as follows; $D_{10} = 23$ mm, $D_{90} = 123$ mm, $D_{50} = 44$ mm with a grading value of $D_{85}/D_{15} = 3.79$ (see Equation 1 in subsection 2.4 for details). The front slope had an incline of 1:6.3 and the toe was located at $x = 256.9$ m and $z = 4.67$ m. Using the runup equation for gravel beaches developed by Poate et al. (2016) the 2 % exceedance runup elevation was predicted to be 0.72 m, therefore the crest was constructed at $x = 260.8$ m and $z = 5.42$ m corresponding to the predicted $R_{2\%}$ for a water level $z_{wl} = 4.7$ m. Behind the crest, the poorly-sorted revetment was approximately horizontal and intersected the sand beach at $x = 264.1$ m. The total volume of placed cobbles was 9.375 m³ and weighed 16.5 t.

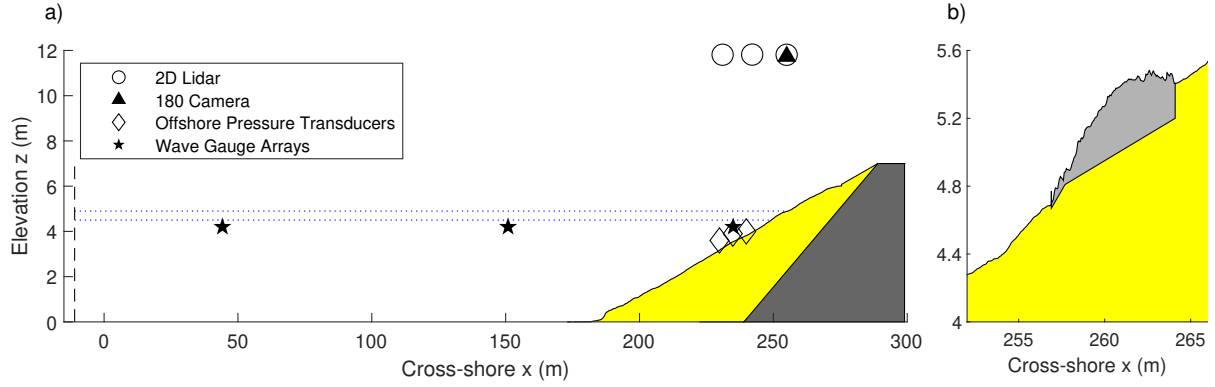


Figure 2: a) Schematic of initial experiment setup including instrument locations and profile of the placed beach. The vertical dashed line indicates the location of the wave paddle and the horizontal dotted lines give the lowest and highest water level during the experiment. b) Close-up schematic of the initial poorly-sorted revetment placement. The grey box is the placed revetment shape.

2.3.1 Instrumentation and Data Acquisition

The instrumentation used to monitor the response of the sand beach and poorly-sorted revetment was the same as that for DynaRev1. Beach profiles were taken at the end of each run using a mechanical profiler which provided measurements of the bed elevation at approximately 2 cm vertical accuracy. Three Sick LMS511 Lidar scanners at $x = 241$ m, $x = 253$ m and $x = 266$ m with elevation $z = 11.8$ m provided continuous measurement of the water surface and exposed beach face morphology over an 80 m transect along the flume centreline. These instruments were sampled at 25 Hz with an angular resolution of 0.1666° . A Vivotek MS8391-EV 180° camera was mounted in the flume roof at $x = 253$ m with elevation $z = 11.85$ m. Once calibrated using ground control points this enabled the generation of timestack imagery of the swash zone which was used for continuous verification of the shoreline position estimated using data from the most landward Lidar (see section 3.4.2).

To track the movement of individual cobbles within the revetment, a radio frequency identification tracking system (RFID) was used as during DynaRev1. A total of 99 cobbles were fitted with 23 mm Passive Integrated Transponder tags (PIT). These were placed in groups of three cobbles along the bottom, middle and top layers of the revetment at 0.4 m cross-shore intervals. At the revetment toe, an additional group of eight cobbles was placed and are considered part of the top layer. The top layer of 48 cobbles was placed along the surface of the revetment from $x = 257.8$ m to $x = 263.0$ m. The middle layer of 30 cobbles was placed from $x = 259.8$ m to $x = 263.4$ m. The bottom layer of 21 cobbles was positioned along the sand-cobble interface between $x = 258.2$ m and $x = 260.6$ m. The cross shore position of each cobble was recorded within 0.2 m accuracy at the end of each test. Due to the size of the PIT tags, only cobbles with an intermediate diameter size greater than 40 mm were able to be tagged and included in the analysis.

2.4 Data Processing

2.4.1 Revetment Volume and Sand Cobble Interface Elevation

The thickness of the revetment down to the underlying sand beach was recorded at 1 m cross-shore intervals along the centreline after each test. This was achieved by driving a thin serrated pole through the structure, the serrated edge would capture sand once through the revetment body and allowed measurements with approximately 2 cm accuracy. The impact on the revetment was minimal and no restorative action was necessary.

to repair the revetment surface. The sand cobble interface profile was estimated through linear interpolation of these elevations under the assumption that the revetment sand interface could not rise during the experiment. Combined with the profiler measurements of the bed elevation, this allowed estimation of both the revetment volume and shape. At the end of the experiment, a channel was excavated along the centreline of the revetment. This exposed the sand cobble interface and was measured by the mechanical profiler.

2.4.2 Swash Detection

High frequency measurements of the exposed beach profile and water surface were obtained using the Lidar array. Each Lidar detects the nearest surface: either the water surface or exposed beach face without distinction between the two. To generate a time series for the beach profile and swash separately, first, a 0.1 m horizontally gridded subsample was created and all measurements were processed with a moving-average 2 s window with a mean variance threshold. Then the data were separated into a stationary bed elevation and a swash surface elevation time series using the method presented by Almeida et al. (2015). The continuous shoreline position was extracted by finding the most landward position of the swash at all time steps. These were validated by plotting the continuous shoreline time series over rectified stacks from the 180-camera (see section 3.3.1) for every run. The difference between the stack imagery and the continuous shoreline position was less than 0.1 m for all tests.

2.4.3 Cross-Shore Grain Size Distribution

The cross-shore variation in surface grain size distribution over the dynamic cobble berm revetment was estimated using a digital point count technique which utilised downward looking images of the revetment surface captured using a digital single-lens reflex (SLR) camera. Photos were taken at 1 m cross-shore increments along a line offset 0.5 m from the flume centreline between $x = 257.5$ m and $x = 264.5$ m immediately after revetment installation and after each test (Table 1). The photographs adhere to the rules of appropriate grain size imagery as presented by Buscombe (2013).

The digital point count software (Buscombe (2010)) estimates the size distribution curve of the intermediate axis length which is considered representative of cobble size (Bunte et al. (2009)) and used to estimate D_{15} , D_{50} and D_{85} . Grading was calculated using the equation presented by van der Meer (1988),

$$Grading = D_{85}/D_{15}, \quad (1)$$

and is considered a good estimate for the spread of the cobble population. An additional measure of spread is provided by the median absolute deviation which is more robust for skewed data. The cobble size distributions obtained from the digital point count software were validated against manual measurements of 100 cobbles randomly selected from within a 1 m² at two locations. This procedure was repeated twice and agreed closely with the image-based results.

3 Results

This section explores the general and morphodynamic behaviour of the beach and dynamic cobble berm revetment constructed from poorly-sorted, angular material during DynaRev-2. These are compared with results presented for the dynamic cobble berm

revetment constructed using well sorted, rounded cobbles during the DynaRev1 experiment (Bayle et al. (2020)) and put in the context of coastal protection. It focuses on both revetment's physical evolution and stability in response to wave attack. Additional analysis of the behaviour of cobbles within the poorly sorted revetment is also presented, including the movement of individual cobbles using the radio frequency identification tracking system (RFID) and the sorting of cobbles over the exposed surface of the revetment, see section 4.1.4 for details. Further, results capturing the wave run-up and shoreline retreat are presented.

3.1 Comparison of Morphological Behaviour

3.1.1 Evolution of Revetment Shape During the Water Level Tests

The morphological evolution of the revetments and sandy beach immediately seaward of the revetment for both DynaRev1 and DynaRev2 is presented in Figure 3a,b. Note that 0 h corresponds to the time of revetment installation, explaining the sudden accretion between $x = 259$ and $x = 262.5$. Negative times correspond to test DR0/2DR0 (see Table 1) before revetment installation, when only the sand beach was present. In both experiments the beach behaved in a similar manner during the 20 h of wave action prior to revetment installation (-20 h to 0 h). The geometry of the revetment at the end of each test is shown in Figure 4 to aid interpretation of Figure 3.

The poorly-sorted revetment in DynaRev2 underwent significant morphological change during the 38 h of standard wave conditions with a rising water level (Table 1). This included both landward retreat of the toe of the main cobble body (hereafter toe) by 2 m and an increase in crest elevation of 0.38 m (Figure 3e; Figure 5b), approximately corresponding to the 0.4 m applied rise in water level. Further, the exposed surface of the revetment changed from a convex profile to a profile with a defined crest and concave front face Figure 4. This evolution differed for the well-sorted revetment (DynaRev1) which was characterised by a sinking of the front face and a more consistent shape that retreated under wave attack (Figure 3e). This was driven by differing rates in the primary modes of cobble transport; landward cobble transport which was induced by wave action on individual cobbles and seaward cobble transport where cobbles rolled down the revetment under gravitational forces. Note that Bayle et al. (2020) defined crest height for the well-sorted revetment in DynaRev1 as the mean elevation of the flat revetment crest area landward of the front slope and cross-shore crest position as the seaward limit of this area. Due to the more defined crest in the poorly-sorted revetment case, these definitions were updated as follows; For the first 14 hours before overtopping occurred and the defined crest developed, the crest was taken at the designed crest's horizontal position. For the rest of the experiment this was defined as the apex of the peaked crest immediately behind the front slope of the revetment, Figure 3e shows the location of the crest for the revetments in DynaRev1 and 2 respectively, both as designed and at the end of water-level tests.

The crest was rarely overtopped during the first 14 hours of testing during DynaRev2 (tests 2DR1 and 2DR2, 0 to 14 h), see Figure 6. The swash zone was limited to the front face of the cobble body and morphological change was confined to this region. Water infiltration into and through the structure eroded sand beneath the front face, reducing the elevation of both the toe and centre of mass of the revetment (red dots in Figure 4, blue diamonds in Figure 5). A single layer of sparse cobbles mixed with sand was formed at the front of the revetment, termed the sparse cobble layer (marked in green in Figure 4). This layer was formed from cobbles at the larger end of the size range, was approximately 1 m in cross-shore extent by $t = 14$ h, did not extend seaward of the

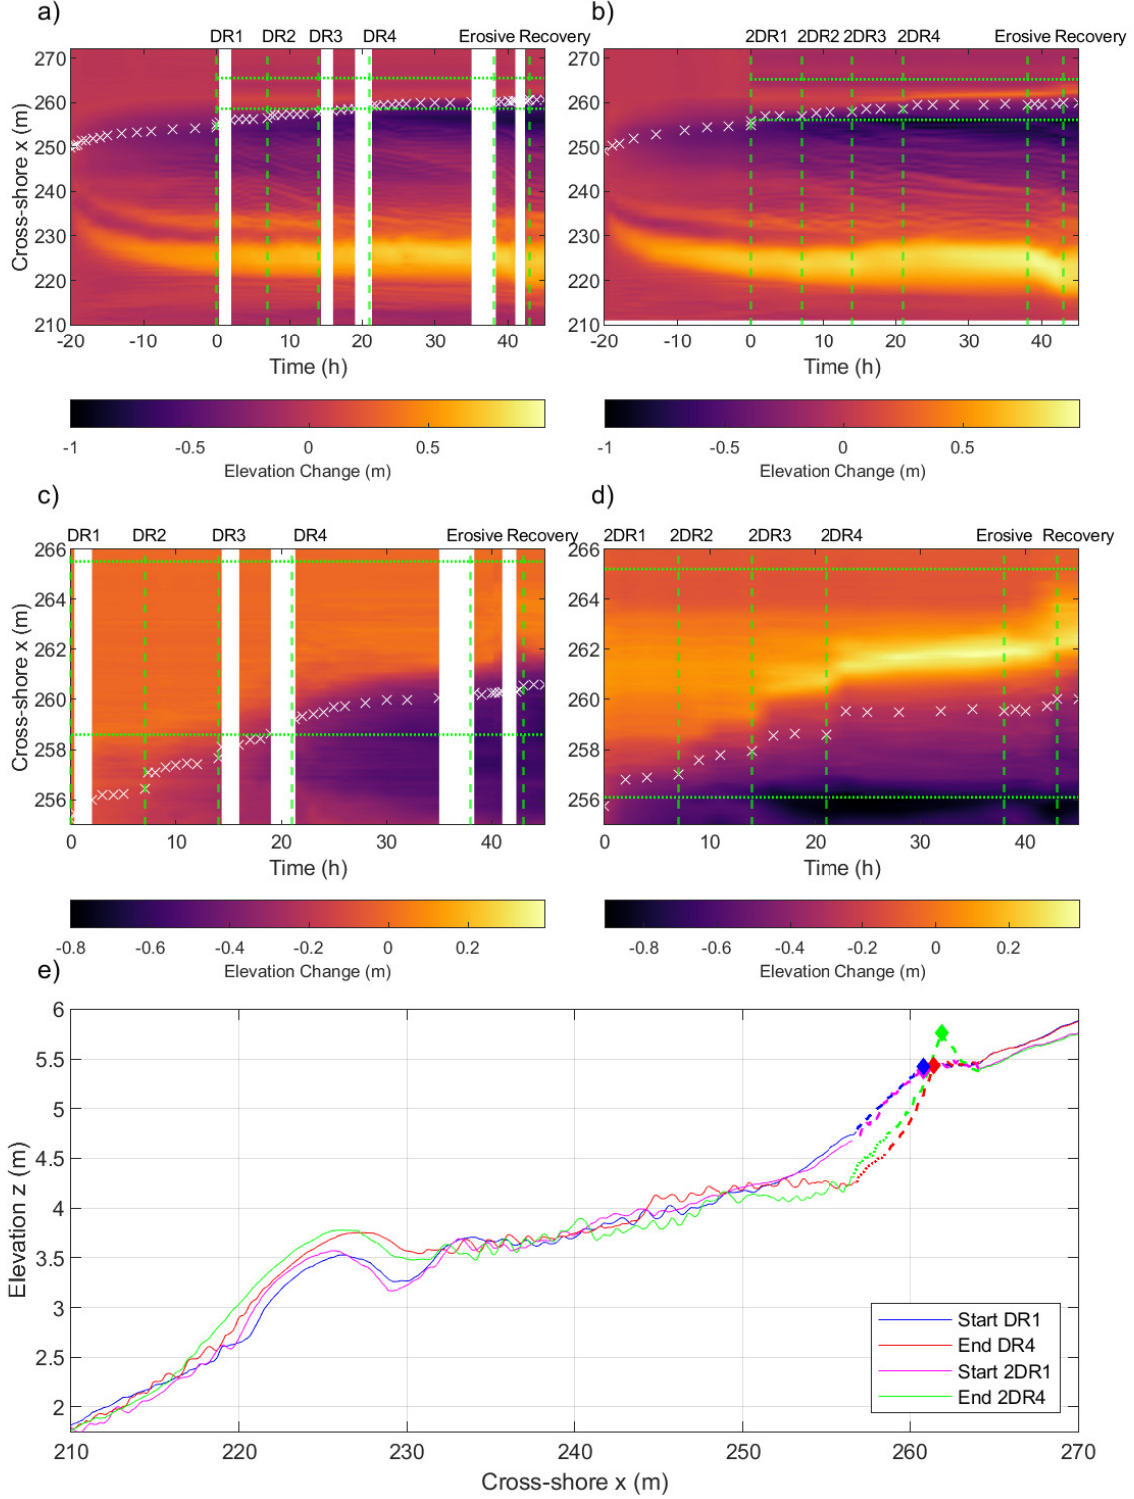


Figure 3: Bed elevation change relative to initial beach profile over the entire experiment for a) DynaRev1, well-sorted revetment, b) DynaRev2, poorly-sorted revetment. Revetment surface elevation change relative to installed profile for c) DynaRev1, d) DynaRev2. The dashed green vertical lines represent the time of a 0.1 m water level rise, and the dotted horizontal lines denote the maximum seaward and landward extent of the revetment during the experiment. The white crosses represent the shoreline position at the end of each run. e) Profile at the start and end of the 38 h of standard wave conditions for both the well-sorted revetment (DynaRev1) and poorly-sorted revetment (DynaRev2). The dashed line represents the cobble body, the dotted line represents the sparse cobble layer and the diamonds gives the crest location (see [section 3.1.1](#)).

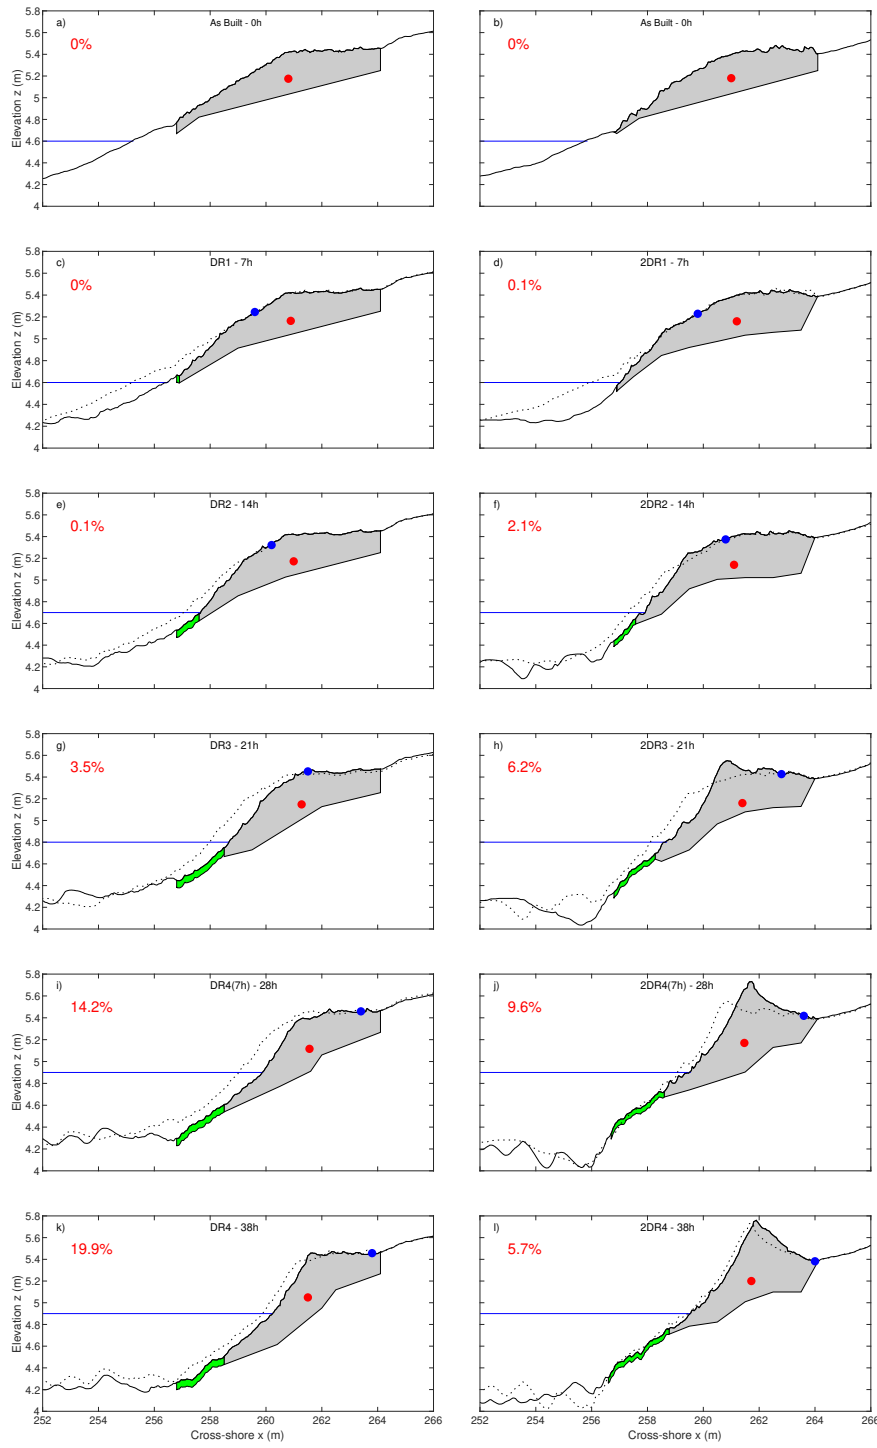


Figure 4: Revetment shape as-built and at the end of each indicated test for the well-sorted revetment (DynaRev1, left) and poorly-sorted revetment (DynaRev2, right). The grey area represents the cobble only portion of the revetment. The green area represents the sparse cobble layer. The blue dot indicates the cross-shore position that was exceeded by 2% of wave run-up events, the red dot indicates the centre of mass of the revetment and the dashed line is the revetment surface from the previous panel. The red value gives the percentage of the main cobble body below the still water level

original toe position and accounted for just 2% of the revetment's original volume. By $t = 14$ h an intermediate berm formed at $x = 259.4$ m just below the 2% run-up elevation (Figure 4f). The well-sorted revetment in DynaRev1 had a similar response and after 14 hours of tests and the geometry of the two revetments at this time was quite similar.

Tests DR3 and 2DR3 ($z_{wl} = 4.8$ m; $t = 14$ to 21 h) resulted in the divergence in the response of the two revetments (Figure 4g and h). The new water level led to an increased rate of overtopping for both revetments driving morphological change, see Figure 6 for further details. Landward transport of cobbles driven by overtopping events led to the development of a very peaked crest behind the initial crest location for the poorly-sorted

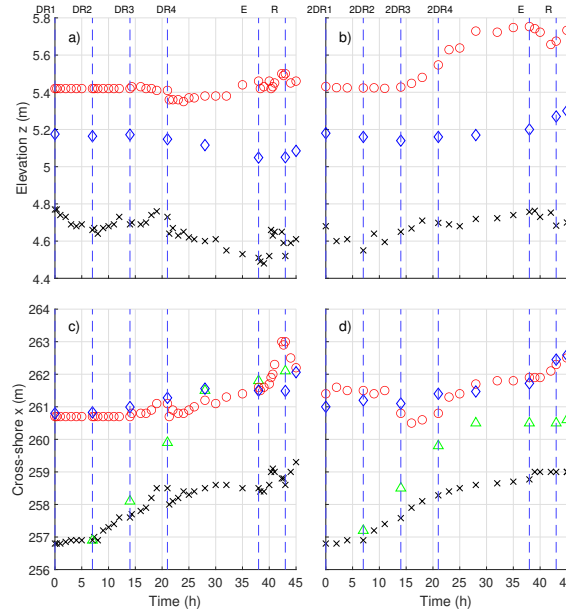


Figure 5: Vertical elevation of the toe (black crosses), centroid of the cross-sectional area (blue diamonds) and crest (red circles) for a) DynaRev1 and b) DynaRev2. Cross-shore location for the toe of the main cobble body (black crosses), the location of the intersection between the still water level and the sand-cobble interface beneath the revetment (green triangles), centroid of the cross-sectional area (blue diamonds) and crest (red circles) for c) DynaRev1 and d) DynaRev2.

revetment (Figure 4h) and a toe retreat of 1 m (Figure 5d). This resulted in an increase in structure height and the front slope changed from a convex to a concave shape (Figure 4h). Conversely, the well-sorted revetment (DynaRev1) showed similar crest and toe retreat but the shape remained consistent with no crest growth (Figure 4g; Figure 5a and c). The development of the peaked crest feature for the poorly-sorted revetment in DynaRev2 is a result of the cobble population characteristics. Firstly, highly angular cobbles interlock better, reducing the frequency of seaward cobble transport due to increased stability under wave attack. Secondly, the wide size range of the poorly-sorted cobbles leads to size sorting on the revetment surface, with larger cobbles accumulating near the toe and primarily smaller cobbles being transported landward to form the peaked crest feature (see section 4.3 for further analysis of surface cobble size distributions). This process results in the elevation gain and landward movement of the crest feature for the poorly-sorted revetment in DynaRev2 as it develops under wave forcing.

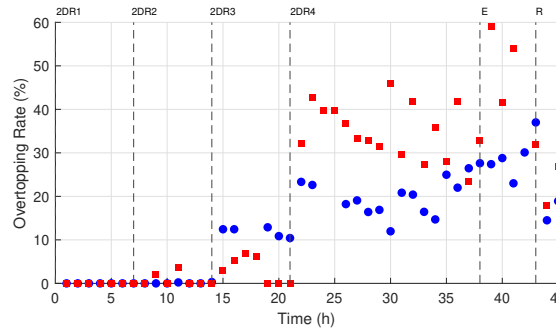


Figure 6: Hourly overtopping rate for the poorly-sorted revetment (blue) and the well-sorted revetment (red).

Tests DR4 and 2DR4 ($z_{wl} = 4.9$ m; $t = 21$ to 38 h) were the longest (17 hours) and experienced the highest overtopping rates (see Figure 6). During the first seven hours the poorly-sorted revetment (DynaRev2) experienced accelerated morphological

change, leading to a 18 cm vertical crest growth and a 90 cm landward retreat. Analysis of the revetment profiles indicates that much of the material that moved onto the top of the structure did so during the first hour of the test (21-22 h) and is detectable in the profile measurement taken at 23 hours (Figure 3d). The toe of the main cobble body continued to retreat (Figure 5d) and the sparse cobble layer occupied the free space in front of the structure (Figure 4j), this was composed of larger cobbles which are less mobile under wave action (see subsection 3.3). The well-sorted revetment in DynaRev1 continued to retreat during hours 21 to 28 ($z_{wl} = 4.9$ m) and began to develop a more prominent crest (Figure 4i), however this did not result in vertical growth of the structure. The rate of morphological change decreased for both revetments over the next ten hours (Figure 4k and l; Figure 5) suggesting they were approaching a dynamic stability. In this state individual cobbles are transported both landward and seaward but the overall shape remains consistent. It is clear that the poorly-sorted revetment was more dynamically stable than the well-sorted revetment between hours 28 and 28 as shown by the consistent location of geometric features such as crest, toe and centre of mass (Figure 5). Therefore, it can be concluded that the poorly-sorted revetment is prone to a more rapid morphological stabilisation as forcing conditions change, with initial wave overtopping promoting the formation of a more substantial and stable crest that subsequently reduces overtopping of the structure, and therefore decreases cobble transport up and over the crest. Both revetments had a final front face slope of 1:3.9, but the centre of mass for the poorly-sorted revetment in DynaRev2 was 0.2 m landward. However this is mainly caused by the formation of the substantial crest feature and is not necessarily indicative of a greater rate of landward retreat. The main cobble body of the poorly-sorted revetment was slightly shorter in cross-shore extent than that of the well-sorted revetment, 5.3 m and 5.6 m respectively.

The cross-shore extent of the main cobble body of both revetments reduced under the standard wave conditions (Figure 4) and are similar throughout the experiment. Because the landward limit of the revetment did not move under stand wave testing, this can be attributed to the retreat of the toe. However, whereas the toe of the well-sorted revetment sank as it retreated due to loss of sand volume beneath the structure, the toe of the poorly-sorted revetment retreated up the beach profile (Figure 5c and d). Therefore, taking the elevation change between the toe and crest as the height of the revetment it appears that both revetments grew rapidly in height under the highest water level ($z_w = 4.9$), but for the poorly-sorted revetment this is due to upward growth of the structure as opposed to the sinking of the sand-cobble interface for the poorly-sorted revetment, leading to a larger elevation change over the body (Figure 4). As noted earlier the well-sorted revetments crest only shows minimal (0.04 m) of growth over the entire standard wave conditions (Figure 5a).

3.1.2 Revetment Response to Erosive and Recovery Wave Tests

In both experiments the water level rise testing was followed by 5 h of erosive wave conditions with increased wave energy at the highest water level, $z_{wl} = 4.9$ m (see section 3.2 for details, Table 1) which resulted in increased overtopping in both DynaRev1 and DynaRev2 (Figure 6). This led to a landward retreat of the centre of mass, flattening of the crest and reducing the front face gradient to 1:3.6 for the poorly-sorted revetment (see Figure 7 a and b). For the well-sorted revetment, the primary response was the retreat of the crest leading to an even lower front face gradient of 1:3.15. For both structures, cobbles were transported beyond the landward limit of the structure (overwash) leading to an increase in the revetment cross-shore extent of 0.8 m (DynaRev1) and 0.9

439 m (DynaRev2). The length of the well-sorted revetment was more variable during the
 440 erosive wave testing due to the more changeable cobble toe location (Figure 5c and d).
 441 The increased stability of the toe in the poorly-sorted revetment is due to the fact that
 442 the toe contained many large cobbles which were not mobilised by the increased wave
 443 energy (subsection 3.3).

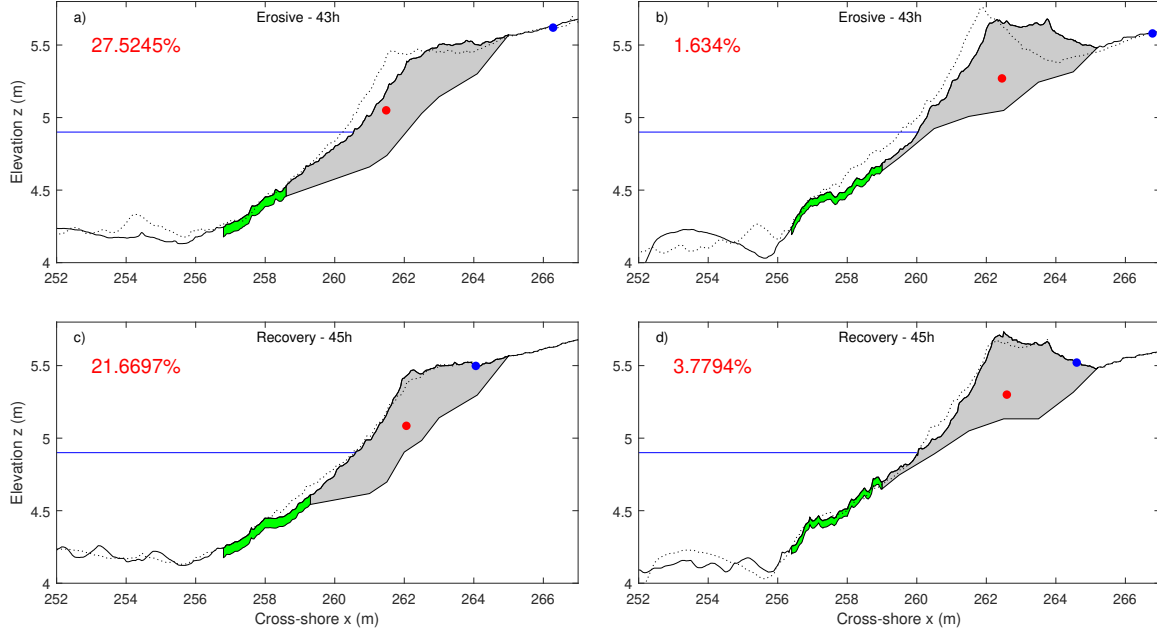


Figure 7: Revetment shape at the end of erosive (2DRE3, 38 to 43 h) and recovery (2DRR1, 43 to 45 h) wave conditions for the well-sorted revetment (left) and poorly-sorted revetment (right). The grey area represents the cobble only portion of the revetment. The green area represents the sparse cobble layer (see subsection 3.1.1). The blue dot gives the cross-shore position which was exceeded by 2% of wave run-up events, the Red dot indicates the centre of mass and the dashed line is the revetment surface from the previous panel for the respective design.

444 The final stage of the revetment testing consisted of 2 h of recovery wave conditions
 445 with the same characteristics as the standard wave conditions ($t = 43$ to 45 h). During
 446 this period, the poorly-sorted revetment began to reform the very peaked crest, but
 447 landwards of its position at the end of the standard wave conditions ($x = 261.9$ m, $t = 38$
 448 h), see Figure 7d. This resulted in the centre of mass being elevated by 0.05 m and
 449 moved landward by 0.2 m compared to the end of the erosive wave conditions (43 h). It is
 450 suggested that the structure would return to approximately the previous shape ($t = 38$ h)
 451 had this test been longer. The well-sorted revetment also began to rebuild a crest similar
 452 to that at the end of standard wave conditions ($t = 38$ h). Overall, both revetments could
 453 be described as showing a general retreat under erosive wave conditions and both were
 454 beginning to reshape under the recovery wave conditions, but with the revetment mass
 455 slightly further landward, however the poorly-sorted revetment in DynaRev2 reformed
 456 above the still water level.

457 3.1.3 Evolution of the Sandy Beach and Revetment Sinking

458 Both beaches were considered to be approaching an equilibrium state and presented
 459 similar morphologies (Figure 3). The notable difference being the slightly larger and
 460 further seaward outer bar in DynaRev2 prior to the installation of the poorly-sorted
 461 revetment. Over the main region of interest between $x = 210$ m and $x = 270$ m the root
 462 mean square difference between the beach profiles at $t = 0$ h was just 0.3 m. This agrees

with the previous finding by Bayle et al. (2020) that laboratory experiments exploring morphological change are repeatable at this scale.

After installation of the poorly-sorted revetment in DynaRev2, the outer bar accumulated sand resulting in a vertical and predominantly seaward growth of the outer bar (Figure 3). The source of this sand is from three primary processes; sand erosion beneath the revetment, the development of a trough immediately seaward of the revetment structure and smoothing out of the smaller inner bar. Morphological changes are strongest in the two hours immediately following the third and fourth water level rise ($z_{wl} = 4.8$ and 4.9 m), the same period in which the revetment and trough underwent significant morphological change. The well-sorted revetment in DynaRev1 showed a similar accretion of sand in the outer bar driven by the same processes. Less sand erodes immediately seaward of the well-sorted revetment leading to a smaller trough, indicating that sand erosion from beneath the structure contributes more for the well-sorted revetment in DynaRev1. The sand erosion beneath the revetment leads to a sinking effect for both revetments. This process can be tracked throughout the experiment by comparing the approximate location that the still water level intercepts the sand-cobble interface beneath the revetment (green triangles in Figure 5). For both revetments this is a continuing process throughout the first three water level tests ($z_{wl} = 4.6$ to 4.8 0 – 27 h). If water level rise is discounted the During the forth water level test (27 – 38h) this process halted for the poorly-sorted revetment in DynaRev2 but continued at a reduced rate for the well-sorted revetment in DynaRev1. This results in a significantly less of the poorly sorted revetments main cobble body being below the still water level at the end of the water level tests (19.9 % in DynaRev1 vs 5.71 % in DynaRev2, Figure 2k and l).

3.1.4 Shoreline Evolution

The shoreline, considered as the intersection between the still water level and seaward facing limit of the poorly-sorted revetment was initially located at $x = 255.8$ m (see Figure 4 b). Over the course of the experiment the shoreline retreated at an average rate of 0.01 m/hour, with a total retreat of 3.7 m although a large degree of this can be attributed to the 0.3 m rise in water level over tests (0-38 h). If there were no changes in the morphology the final shoreline would be expected to be at $x = 258$ m (a retreat of 2.2 m). The final shoreline was located at $x = 259.5$ m giving a true retreat of 1.5 m when discounting water-level rises, which was under half the true retreat of 3.7 m for the well-sorted revetment (see Figure 4 k,l). A major reason for lesser retreat in the poorly-sorted case is the reduced loss of sand from beneath the revetment and hence reduced sinking of the front face of the revetment. This can be seen clearly in the retreat of the sand water interfaces (SWI) for the revetments (see Figure 5 c,d), the location where the still water line intercepts the interpolated surface beneath the revetment. The final SWI location for the poorly-sorted revetment was 260.5 m at the end of standard wave conditions (38 h), which is 1.3 m further seaward than for the well-sorted revetment (see Figure 5). The poorly-sorted revetment preserves up to 52% more sand above the still water level under the structure. This reduced sand loss has the advantage of better preserving the revetment height compared to the still water level improving the ability to reduce overtopping.

3.2 Overtopping Rates

A comparison of the overtopping rates on an hour by hour basis using the Lidar array during both experiments is provided in Figure 6. The values for both experiments are similar between $t = 0$ h and $t = 14$ h ($z_{wl} = 4.6$ m and $z_{wl} = 4.7$ m). Overtopping of

the designed crest was infrequent during this time period (Figure 6) and the increased horizontal runup excursion between $t = 7$ h and $t = 14$ h ($z_{wl} = 4.7$ m) for DynaRev2 is explained by the crest being constructed slightly landward of that for DynaRev1 (see subsection 2.3 for details of the construction). As the water level increased further, the crest of both revetments began to be regularly overtopped (0-8 % DynaRev1, 11-13% DynaRev2) (Figure 6) and this led to substantial crest growth for the poorly-sorted revetment (DynaRev2). Despite the large crest growth in DynaRev2, the revetment experienced higher overtopping rates than for DynaRev1 at $z_{wl} = 4.8$ m. This may be due to the fact that the crest of the revetment in DynaRev2 is 0.3 m seaward of the DynaRev1 crest and it was demonstrated by Blenkinsopp et al (2022) that overtopping rates decay rapidly with cross-shore distance. Alternatively, the water depth seaward of the revetment is consistently larger for DynaRev2, allowing more wave energy to reach the shoreline and drive runup Blenkinsopp et al. (2022). After increasing the water level to $z_{wl} = 4.9$ m, the overtopping rates increased again. This led to rapid crest growth during the first hour at the new water level for DynaRev2 which acted to limit overtopping to 23%, compared to 31% in DynaRev1 where crest growth was minimal. It is noted that there is substantial variability in the overtopping rates during both experiments and this is thought to be due to the fact that the geometry of the structures is constantly evolving, meaning that the instantaneous crest elevation is varying and provides variable rates of overtopping protection.

The overtopping rate in both experiments increased further during the erosive tests (38-43 h; Table 1). For the poorly-sorted revetment in DynaRev2, the overtopping rate increased by less than 10% compared to the final hour of wave testing under standard wave conditions (28%, 37-38 h in Figure 6) and at no point was the structure's crest overtopped by more than 38% of the waves in any given hour. Conversely, overtopping of the well-sorted DynaRev1 revetment was very variable and reached as high as 59% (38-39 h in Figure 6), this is 26% larger than the final value under standard wave conditions (33%, 37-38 h in Figure 6). Overall, the ability of a revetment constructed from poorly-sorted, angular material to form an elevated crest is beneficial as it reduces overtopping of the structure and provides increased resilience under energetic wave conditions. The poorly-sorted revetment's ability to rapidly develop a significant crest feature suggests that it is highly adaptable to a rising water level.

3.3 Cobble Transport and Surface Sorting

For both experiments cobbles tagged with passive RFID transmitters were placed along the cross shore centreline of the revetment in three layers; On the surface (top), at half the revetment depth (middle) and along the cobble-sand interface (bottom). Figure 9 details the movement of the cobbles for both the poorly-sorted (DynaRev2) and well-sorted revetment (DynaRev1) by placement layer, Table 2 provides further details on the quantity of tagged cobbles transported and direction of travel. This was supported by an analysis of the surface cobble size distribution (intermediate axis length) along the central axis of the poorly-sorted revetment using a digital cobble count method (Figure 8, see section 3.4.4 for methodological details). Photos of the toe and crest of the poorly-sorted revetment at the end of the standard wave conditions are provided in Figure 10, these give a visual reference for the results presented. The well-sorted revetment had a consistent grading and a small range of cobble sizes and so no size sorting was observed.

The distribution of cobbles on the surface of the poorly-sorted revetment was initially very consistent at all cross-shore positions (Figure 8a). Subsequently, the surface cobbles underwent a sorting process throughout the experiment as they were mobilised by wave

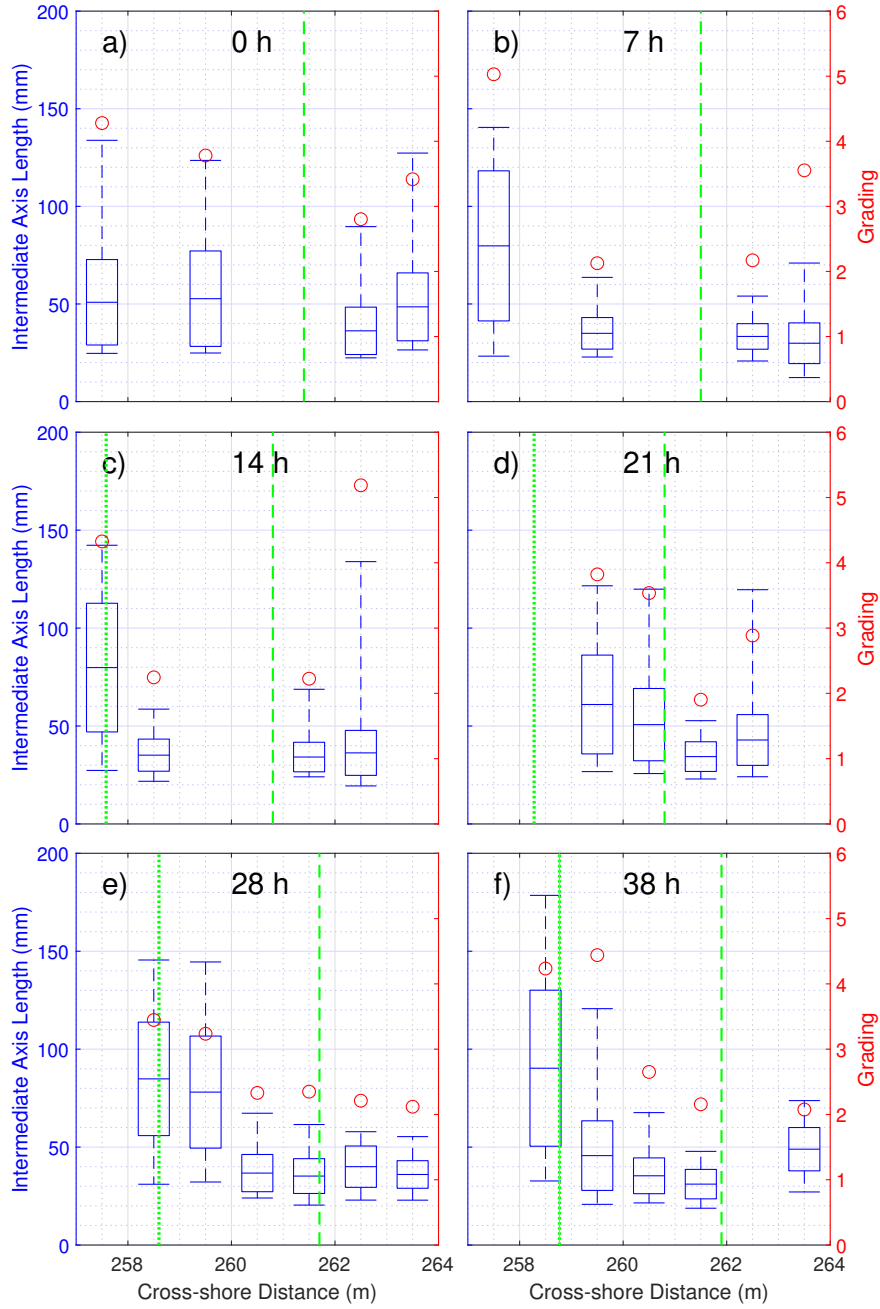


Figure 8: Surface grain size distribution across the poorly-sorted revetment at the end of each test ($t = 0, 7, 14, 21, 28, 38$). The left hand y-axis corresponds to a box plot centred over the median intermediate axis length with inner bounds provided by the median absolute deviation and branches reaching D_{90} and D_{10} . The right hand y-axis and red circles indicate the grading value at each location (Grading = D_{85}/D_{15}). Dotted green line represents the toe location and dashed green line represent crest location.

forcing. This sorting process led to the median cobble size decreasing landward of the toe, combined with a smaller grading value (Figure 8), indicative of better sorted cobbles moving landwards. This sorting was limited to the seaward limit of the revetment during test 2DR1 (0-7 h, $z_{wl} = 4.6$ m) when no overtopping occurred (see Figure 8b). Overtopping appears to accelerate this process by transporting smaller, more easily mobilised cobbles onto and landward of the crest during uprush where they become stranded and bury existing larger cobbles. This sorting is most evident during the final water level test 2DR4 (21-38 h, $z_{wl} = 4.9$ m; see Figure 8 e,f) and is visible in the images shown in

Figure 10 for both the toe and crest of the revetment. Throughout the experiment both the smallest range of cobble sizes and smallest median cobble sizes were detected at the crest of the structure (see Figure 8). Note, the RFID-tagged cobbles had a minimum size of 40 mm and therefore this trend is not evident in Figure 9 because the majority of cobbles forming the crest are smaller than 40 mm. Conversely, the toe of the revetment and the sparse cobble layer became less sorted with a higher median cobble size than was initially present (see Figure 8). The median cobble size at the toe increased from 51 mm at 0 h to 90 mm at 38 h. This is caused by a high proportion of smaller cobbles being transported landward from the toe, leaving the larger, less easily mobilised cobbles to form a stable toe for the revetment. Notably, no tagged cobble of weight greater than 2 kg was detected more than 40 cm landward of its initial position by the end of standard wave testing (38 h, see Figure 9 b). Some cobbles larger than 2 kg were detected seaward of their initial position. These are primarily from the surface and middle layer of the revetment and have rolled down the front face of the revetment. A comparison of the

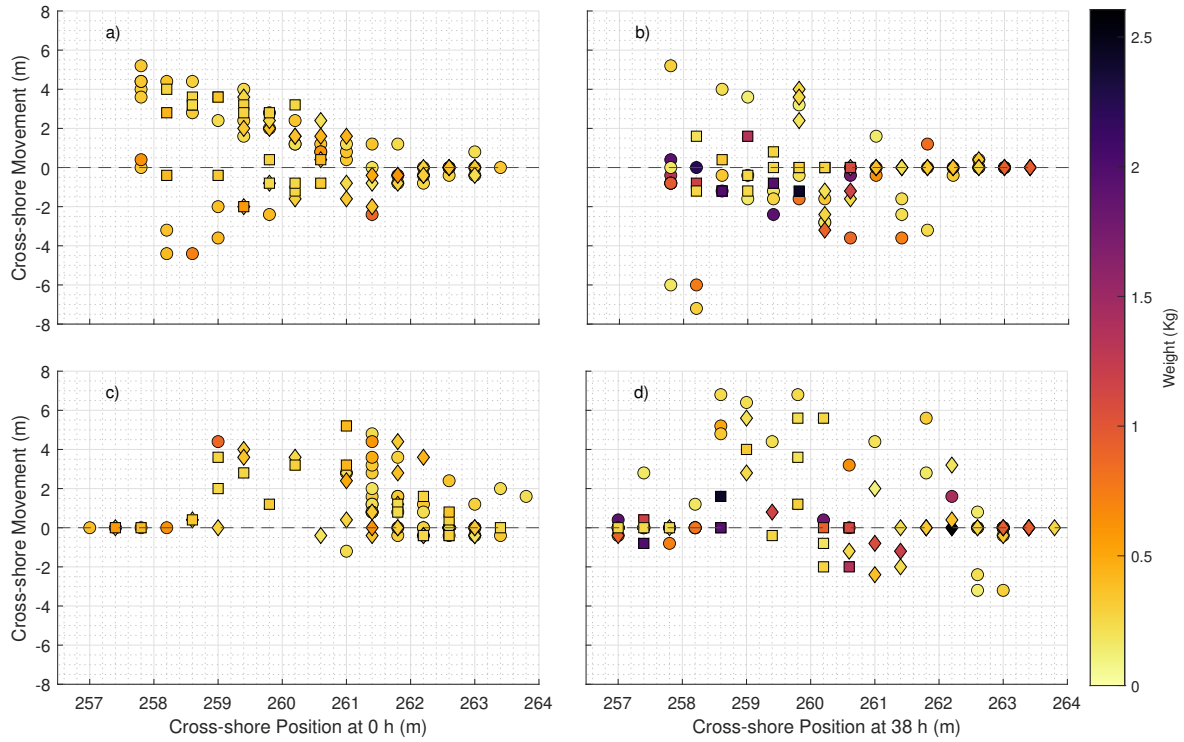


Figure 9: Absolute cross-shore distance travelled by tagged cobbles from their initial position, where positive is landward and negative is seaward for the a) well-sorted revetment (DynaRev1) and b) poorly-sorted revetment (DynaRev2) after 38 h of standard wave conditions. Absolute distance travelled by tagged cobbles from their detected position at 38h for the c) well-sorted revetment and d) poorly-sorted revetment during the erosion and recovery tests. The colour of each marker relates to the cobble weight as shown by the colour bar (left). The cobbles were distributed in three layers; revetment surface (circles), middle layer (diamonds) and sand-cobble interface (squares).

transport of tagged cobbles by layer for both the poorly and well-sorted revetments is shown in Table 2. At the end of standard wave testing ($t = 38$ h) only 54% were moved from their initial position for the poorly-sorted revetment (DynaRev2), predominantly in the seaward direction (see Table 2 and Figure 9 b). The cobbles forming the well-sorted revetment were more mobile, with 87% displaced from initial position, primarily in the landward direction (see Table 2 and Figure 9 a). It is important to note however that the largest tagged cobbles for the well-sorted revetment had an intermediate axis size (D_{50}) less than 100 mm, meaning that the whole tagged cobble population was more

Table 2: Percentage of cobbles displaced from initial position by cross-shore direction at the end of standard wave conditions (38 h) and the end of recovery test (45 h) for the well-sorted revetment (WS, DynaRev1) and poorly-sorted revetment (PS, DynaRev). This is further broken down by placement layer of cobbles and several size categories

Cobbles Displaced from Initial Position		Total (%)		Landward (%)		Seaward (%)		Not Detected (%)		Average Landward Transport (m)	
		WS	PS	WS	PS	WS	PS	WS	PS	WS	PS
38 h	All	87	54	52	15	35	39	7	6	0.88	-0.45
	Surface	85	68	57	14	28	54	4	12	1.05	-0.65
	Middle	79	30	34	13	44	17	17	0	0.31	0.08
	Bottom	100	57	64	19	34	38	0	0	1.52	-0.3
45 h	All	80	60	60	27	20	33	16	21	2.08	0.69
	Surface	85	65	66	33	19	32	10	20	2.38	0.80
	Middle	70	43	43	16	27	27	30	30	1.54	0.18
	Bottom	85	71	75	28	10	43	10	9	2.87	0.93

susceptible to mobilisation by wave action. The movement of the tracked RFID cobbles was markedly different between the two experiments. For the well-sorted revetment (DynaRev1) the cobbles showed a cyclic pattern of being dragged down to the toe when exposed, these were then transported up and over the crest by overtopping events where they were swiftly reburied by cobbles. For the poorly-sorted revetment (DynaRev2), the cobbles were either dragged down into the toe of the revetment ($D_{50} > 100$) or transported over the crest upon being exposed ($D_{50} < 75$). At the end of the poorly-sorted revetment testing ($t = 45$ h), the quantity of tagged cobbles displaced from their initial position increased and the primary direction of travel became landward with an average displacement of 0.69 m (see Table 2 and Figure 9 d). The erosive testing ($t = 38$ to 43 h) was characterised by increased wave energy resulting in a greater ability to transport heavier cobbles landward, combined with the exposure of tagged cobbles that were initially deeper within the revetment. This led to an increase in the proportion of tagged cobbles being displaced (Table 2).

Additionally, behaviour of the tagged cobbles varied between the two revetments depending on the initial placement location (layer and cross-shore location). In both cases, tagged cobbles placed on the surface and in front of the final crest location for standard wave conditions ($x = 261.5$ m for DynaRev1 and $x = 261.9$ m for DynaRev2) were most mobile. Cobble displacement in the middle layer was low for both revetments due to the placement starting at $x = 259.4$ m. The bottom layer of cobbles were highly mobile for DynaRev1. This suggests that overall, the poorly-sorted revetment is less morphologically active at vertical depth than the well-sorted revetment, this is due to the strong interlocking nature of poorly-sorted cobbles.



Figure 10: Photo of surface cobbles for the poorly-sorted revetment after standard wave conditions (38 h) at left) the toe of the revetment and right) the crest of the revetment. The total length of the scale bar is 198 mm.

3.4 Renourishment

Following the erosive and recovery wave conditions (38-45 h, Table 2) the thickness of the poorly-sorted revetment on the seaward slope had thinned substantially and the revetment consisted of a large crest feature with the majority of volume above the SWL, with a thin layer of larger stones extending to the original toe location ($x = 256.9$ m) (see Figure 4). An opportunistic nourishment of the front slope was carried out where an additional 2.25 m^3 of material was added by simply dumping it on the front face (Figure 11a). Additional erosive test were then carried out, these are not comparable to those carried out for the well-sorted revetment due to a shortened testing regime and different placement method - for the well-sorted revetment the renourishment was added as a constant thickness layer over the front face. The material added to the poorly-sorted revetment in DynaRev2 was quickly reshaped by waves and integrated into the revetment. This had the primary effect of increasing the cobble depth of the front face but some material was transported beyond the landward limit of the revetment, increasing its length by 2 m. During these tests the toe retreated by a further 0.5 m but the crest was stabilised at the pre-nourishment location ($x = 262.45$ m). The renourished revetment preserved its centre of mass beneath the peak of the crest and 0.22 m higher than the end of the resilience tests (38 h, 2DDR1) suggesting this is the most stable shape for these cobble characteristics. The overall effect of the added material was to increase the thickness of the front slope without affecting the overall behaviour of the revetment which continued to reshape rapidly in response to changing conditions.

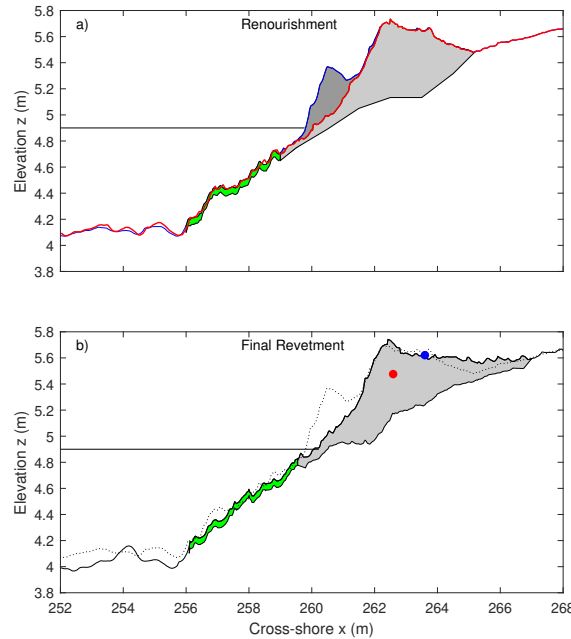


Figure 11: a) Renourished revetment where the light grey area outlined in red shows revetment cross-shore profile at the end of recovery wave conditions (2DDR1, 45 h, Table 1) and the dark grey area outlined in blue indicates the added material. b) The final shape of the revetment after 2 h 40 m of additional tests, the blue dot indicates the runup location under standard wave conditions. The dotted line indicates the revetment profile immediately following renourishment

4 Discussion

This section presents the current work wider context of both composite beaches and dynamic revetments. It further comments on the application of these structures as coastal

635 protection.

636 The majority of revetment response in DynaRev2 happened within the first seven
637 hours of test 2DR4 (21 – 28 h), after this the retreat slowed (Figure 5) and the degree of
638 morphological change greatly reduced during the final 10 hours of standard wave condition
639 testing (28–38 h), Figure 3) was reduced. This suggests that the revetment moves towards
640 an equilibrium state within approximately 7 hours after each rise in water level. The
641 ability of the revetment to rapidly reshape towards a new equilibrium condition is also
642 seen in Figure 7 which shows that the revetment responds quickly to erosive conditions
643 but is already re-establishing the peaked revetment crest after only 2 h of low energy
644 recovery conditions. As the bulk of material remains part of the main cobble body and the
645 geometry remains approximately constant, the revetment can be considered dynamically
646 stable even though cobbles are moving with every wave. Further investigation involving
647 longer testing at each water level, as well as larger water level increases is suggested to
648 give additional insight into the time for a stable geometry to be reached and the level of
649 coastal protection provided.

650 The behaviour of the cobble body for the poorly-sorted revetment in DynaRev2 under
651 wave attack is that of a coherent structure, see Figure 4. The location of the toe, crest
652 and centre of gravity retreat in unison under standard wave conditions (Figure 5), which
653 can be viewed as a retreat of the whole body. Further, the cobble body of the revetment
654 is estimated to contain up to 97% of the original material at the end of the testing ($t = 45$
655 h). The rapid development of a peaked crest constructed from smaller angular cobbles
656 acted to limit overtopping to a greater degree than that shown in DynaRev1. Overtopping
657 was highest after the revetment crest was pushed over landward by a series of energetic
658 overtopping events, reducing the effective crest height (see 41-43 h in Figure 5 b). This
659 highlights the importance of the crest for protecting the upper beach and hinterland from
660 wave inundation.

661 The lack of variation in cobble size and the rounded nature of the cobbles for the
662 well-sorted revetment are the primary reasons for the different morphological responses
663 observed and are thought to be responsible for the large loss of sand and sinking of the
664 structure. Loss of sand beneath the revetment and associated sinking was much reduced
665 for the well-sorted revetment and this is thought to be due to the development of a layer
666 of small gravels at the sand-cobble interface which acts as a filter layer and prevents sand
667 from escaping. The material for existing dynamic cobble berm revetments is often poorly-
668 sorted local material (Komar and Allan (2010); Weiner et al. (2019)) and sinking has not
669 been reported at these sites. Bayle et al. (2021), reported a similar "natural filter layer" of
670 small gravel at the sand-cobble interface of a poorly-sorted revetment at North Cove and
671 they reported short term sand accumulation and loss within the cobble matrix driven by
672 both wave and aeolian processes, but no evidence of sinking. It is suggested therefore that
673 a wide size grading of gravel material should be used when constructing dynamic cobble
674 berm revetments. The results presented here also suggest that angular cobbles increase
675 interlocking and hence the stability of the revetment crest, which provides overtopping
676 protection to the back of the revetment and hinterland.

677 Similarly the wide size distribution and lower mobility of the interlocking angular
678 cobbles in the poorly-sorted revetment (DynaRev2) meant that the average landward
679 movement of cobbles during the erosive wave conditions was substantially smaller than
680 for the well-sorted case (DynaRev1): 0.69 m and 2.08 m respectively. This meant that
681 the tagged cobble population was far less mobile during DynaRev2 despite the degree
682 of morphological change presented. In the analysis, a cobble was only categorised as
683 displaced if it was detected at the end of the given test, while cobbles that were not
684 detected at all were categorised as 'not detected'. The decrease in the total number of

displaced cobbles for the well-sorted revetment during the erosion and accretion testing (87% to 80%) is therefore explained by the greater number of non-detected cobbles and not an indication of a reduced quantity of transported tagged cobbles. As a result, it is probable that the displacement of tagged cobbles during both experiments is under represented.

Overall, given the differing morphological response of the two revetments, it is arguable that the new design for DynaRev2 performed better. The development of the filter layer prevented the structure from sinking. When combined with the crest growth it maintained the majority of the main cobble body above the water level till the end of the experiment (96.2 %, 2DDR1, 45 h). Additionally, the structure maintained a significant difference in height between the crest peak and still water level. This reduced overtopping providing better protection to the upper beach. This suggests that a key consideration for dynamic cobble berm revetment design is the characteristics of the cobbles used for construction. As a result it may be desirable to use angular, or at least sub-angular material when constructing dynamic cobble berm revetments, though this has implications for the recreational function of the beach and is not in keeping with the natural character of composite beaches.

Maintenance of dynamic cobble berm revetments is vital to their long-term efficacy. The renourishment of the structure suggests that there is no need to carefully place the renourishment material. It is sufficient to simply dump the material on the revetment front face where it will be rapidly reshaped by wave action. It is likely in fact that a revetment could be initially constructed by simply dumping material around the high tide line and allowing wave action to shape the berm, however this has not been tested.

The 2D nature of wave flume experiments has limitations which were present in the current study. Primarily, longshore transport cannot be represented in laboratory environments. While cross-shore processes are expected to primarily influence the revetment during storm conditions and be the major driver of morphological change, the long term impact of longshore cobble transport could influence the lifespan of the structure. Future field studies of dynamic cobble berm revetments and composite beaches should investigate longshore processes including longshore cobble transport. The resulting findings will better inform re-nourishment schemes for dynamic cobble berm revetments. One approach currently being tested at North Cove, USA is a sacrificial feeder bluff of cobbles updrift of the dynamic cobble berm revetment however the efficacy of this is not yet clear.

A further issue in terms of the design and analysis of dynamic cobble berm revetments is the lack of numerical modelling tools. An investigation by McCall et al. [McCall et al. \(2019\)](#) found that although the Xbeach-G gravel beach model accurately reproduced morphology changes in some cases, it couldn't represent the sand erosion beneath the revetment structure and associated lowering of the sand-cobble interface observed during the DynaRev experiment. As noted above, it is likely that this effect was enhanced due to the use of very well-sorted round cobbles and was much less evident during the DynaRev2 experiment and on composite beaches and dynamic revetments in the field. As a result DynaRev1 may not be an ideal validation case and additional testing of DynaRev2 in XBeach-G is recommended.

5 Conclusions

The purpose of a dynamic revetment is to provide protection to the hinterland as well as reducing erosion of the upper beach face. It is clear that both the well and poorly-sorted revetments are appropriate for this purpose based on the experimental results, with the caveat that the observed sinking process needs to be better understood. Both revetments

reduced the horizontal runup excursion compared to a sand beach only case (see Bayle et al. (2020)) and the erosion of the beach face is significantly less than during the sand-only case measured during the DynaRev experiment. Further, both revetments remained dynamically stable and maintained the majority of their cobble mass during testing.

For both revetment designs wave overtopping of the crest location is required for morphological change. As overtopping greatly increased after each water level increase so did the rate of morphological change. However, this morphological change reduces as both designs move towards a new dynamic stability, where cobbles are free to move under wave action but the structure maintains a consistent shape. The revetment in DynaRev1 constructed using well-sorted, rounded cobble material developed a low flat crest with sinking beneath the seaward face of the revetment throughout the entire experiment. Conversely the poorly-sorted angular revetment in DynaRev2 gained elevation through the development of a peaked crest due to both the strong interlocking nature of the cobbles used and the sorting effect sending smaller cobbles up the front face of the revetment under wave action. A sinking effect was only observable up to 28h and slowed substantially after 14h. It is hypothesised that this is due to the ability of poorly-sorted material to form a filter layer at the intersection between the sand and the structure, this reduces water percolating into the sand preventing its erosion. It is estimated that cobbles will become rounded in 2 to 5 years when placed in the structure (Allan and Gabel (2016)) however the fragmented gravels will maintain the filter layer. The revetment in DynaRev2 gave a better reduction in the amount of overtopping but both designs limited wave excursion to the landward limit of the structure for all but the largest runup events.

Long-term studies of dynamic cobble berm revetments in the field are now required to ascertain their long term viability, however some re-nourishment of the structures is likely to be needed in most locations either through periodic renourishment or installation of an updrift feeder bluff. If direct renourishment is required, this can be done by simply dumping stone on the front face and allowing wave action to reshape the material.

The uptake of these structures is dependent on more than just their coastal protection performance. Many coastal protection schemes are concerned with the ecological impact, environmental impact, aesthetics and cost of any proposed coastal works. The ecological impact of these structures is yet to be determined. However, the two designs provide a more aesthetic but costly solution in DynaRev1 and a cheaper but less aesthetic solution in DynaRev2. Further, if constructed using locally sourced material the cost and environmental impact would be low compared to more substantial coastal works such as sea walls, due to the ease of construction (simple dumping of stone) and reduced need to transport material. The final consideration is that many coastal protection bodies are looking to create more ‘natural’ defences for preservation of the coastline (Pye and Blott (2018)), dynamic cobble berm revetments fulfill this requirement.

Declaration of competing interests

The authors declare that they have no known competing financial interests or personal relationships that could have appeared to influence the work reported in this paper.

CRediT authorship statement

Ollie Foss Conceptualization, Methodology, Formal analysis, Investigation, Data curation, Writing - original draft, Writing - review & editing, Visualization. **Chris E Blenkinsopp** Conceptualization, Methodology, Investigation, Resources, Writing - re-

view & editing, Supervision, Project administration, Funding acquisition. **Paul M. Bayle** Conceptualization, Methodology, Formal analysis, Investigation, Data curation, Writing - review & editing. **Kévin Martins** Investigation, Writing - review & editing. **Stefan Schimmels** Investigation, Writing - review & editing. **Luis Pedro Almeida** Investigation, Writing - review & editing.

Acknowledgements

Funding: The DynaRev1 project received funding from the European Union’s Horizon 2020 research and innovation programme under grant agreement No 654110, HYDRALAB+. The DynaRev2 project received funding from the Research England Global Challenges Research Fund. Ollie Foss and Paul Bayle were supported by a PhD scholarship through the EPSRC CDT in Water Informatics: Science and Engineering (WISE). Kévin Martins acknowledges financial support from the University of Bordeaux, through an International Postdoctoral Grant (Idex, nb. 1024R-5030).

The authors would like to sincerely thank Matthias Kudella and all the staff at the Großber WellenKanal (GWK) for their support before, during and after both experiments. Additionally the authors acknowledge all colleagues who contributed to the DynaRev1 experiment.

References

- Allan, J.C., Gabel, L.L., 2016. Monitoring the Response and Efficacy of a Dynamic Revetment Constructed Adjacent to the Columbia, River South Jetty, Clatsop County, Oregon. Technical Report O-16-07. Oregon Department of Geology and Mineral Industries. State of Oregon.
- Allan, J.C., Komar, P.D., 2004. Environmentally compatible cobble berm and artificial dune for shore protection. *Shore & Beach* 72, 9–18.
- Almeida, L.P., Masselink, G., Russell, P.E., Davidson, M.A., 2015. Observations of gravel beach dynamics during high energy wave conditions using a laser scanner. *Geomorphology* 228, 15–27. URL: <http://www.sciencedirect.com/science/article/pii/S0169555X14004279>, doi:10.1016/j.geomorph.2014.08.019.
- Bayle, P.M., Blenkinsopp, C.E., Conley, D., Masselink, G., Beuzen, T., Almar, R., 2020. Performance of a dynamic cobble berm revetment for coastal protection, under increasing water level. *Coastal Engineering* 159, 103712. URL: <https://www.sciencedirect.com/science/article/pii/S0378383919304995>, doi:10.1016/j.coastaleng.2020.103712.
- Bayle, P.M., Kaminsky, G.M., Blenkinsopp, C.E., Weiner, H.M., Cottrell, D., 2021. Behaviour and performance of a dynamic cobble berm revetment during a spring tidal cycle in North Cove, Washington State, USA. *Coastal Engineering* 167, 103898. URL: <https://www.sciencedirect.com/science/article/pii/S0378383921000582>, doi:10.1016/j.coastaleng.2021.103898.
- Blenkinsopp, C.E., Bayle, P.M., Martins, K., Foss, O.W., Almeida, L.P., Kaminsky, G.M., Schimmels, S., Matsumoto, H., 2022. Wave runup on composite beaches and dynamic cobble berm revetments. *Coastal Engineering* 176, 104148. URL: <https://www.sciencedirect.com/science/article/pii/S0378383922000631>, doi:10.1016/j.coastaleng.2022.104148.

- 821 Bunte, K., Abt, S.R., Potyondy, J.P., Swingle, K.W., 2009. Comparison of Three
822 Pebble Count Protocols (EMAP, PIBO, and SFT) in Two Mountain Gravel-Bed
823 Streams. JAWRA Journal of the American Water Resources Association 45, 1209–
824 1227. URL: [https://onlinelibrary.wiley.com/doi/abs/10.1111/j.1752-1688.](https://onlinelibrary.wiley.com/doi/abs/10.1111/j.1752-1688.2009.00355.x)
825 2009.00355.x, doi:10.1111/j.1752-1688.2009.00355.x.
- 826 Buscombe, D., 2010. eyeballs_pc.m, available as part of the dgs_apr2012_matlab_code.zip
827 repository available at <https://walrus.wr.usgs.gov/seds/grainsize/code.html>. Adapted
828 version available by request from Ian Miller.
- 829 Buscombe, D., 2013. Transferable wavelet method for grain-size distribution from im-
830 ages of sediment surfaces and thin sections, and other natural granular patterns.
831 Sedimentology 60, 1709–1732. URL: <http://doi.wiley.com/10.1111/sed.12049>,
832 doi:10.1111/sed.12049.
- 833 Cartwright, A., Brundrit, G.B., Fairhurst, L., 2008. Global climate change and adap-
834 tation—a sea-level rise risk assessment. Phase four: Adaptation and risk mitigation
835 measures for the City of Cape Town. Prepared for the City of Cape Town by LaquaR
836 Consultants CC .
- 837 Cooper, A., Jackson, D., 2021. Dune gardening? A critical view of the contemporary
838 coastal dune management paradigm. Area 53, 345–352. URL: [https://rgs-ibg.](https://rgs-ibg.onlinelibrary.wiley.com/doi/abs/10.1111/area.12692)
839 [onlinelibrary.wiley.com/doi/abs/10.1111/area.12692](https://rgs-ibg.onlinelibrary.wiley.com/doi/abs/10.1111/area.12692), doi:10.1111/area.
840 12692. eprint: <https://rgs-ibg.onlinelibrary.wiley.com/doi/pdf/10.1111/area.12692>.
- 841 Dean, R.G., 1973. Heuristic Models of Sand Transport in the Surf Zone. First
842 Australian Conference on Coastal Engineering, 1973: Engineering Dynamics of the
843 Coastal Zone , 215URL: [http://search.informit.com.au/documentSummary;dn=](http://search.informit.com.au/documentSummary;dn=971703171672500;res=IELENG)
844 [971703171672500;res=IELENG](http://search.informit.com.au/documentSummary;dn=971703171672500;res=IELENG). publisher: Institution of Engineers, Australia.
- 845 DeConto, R.M., Pollard, D., 2016. Contribution of Antarctica to past and future sea-level
846 rise. Nature 531, 591–597. doi:<https://doi.org/10.1038/nature17145>.
- 847 Everts, C.H., Eldon, C.D., Moore, J., 2002. Performance of cobble berms in Southern
848 California. Shore and Beach 70, 5–14.
- 849 French, P.W., 2001. Coastal Defences: Processes, Problems and Solutions. Psychology
850 Press.
- 851 Gourlay, M., 1968. Beach and Dune Erosion Tests. Technical Report M935/M936. Delft
852 Hydraulic Laboratory. the Netherlands.
- 853 Hallegatte, S., Green, C., Nicholls, R.J., Corfee-Morlot, J., 2013. Future flood losses
854 in major coastal cities. Nature Climate Change 3, 802–806. URL: [https://www.](https://www.nature.com/articles/nclimate1979/)
855 [nature.com/articles/nclimate1979/](https://www.nature.com/articles/nclimate1979/), doi:10.1038/nclimate1979. number: 9 Pub-
856 lisher: Nature Publishing Group.
- 857 Hino, M., Field, C.B., Mach, K.J., 2017. Managed retreat as a response to natural hazard
858 risk. Nature Climate Change 7, 364–370. URL: [https://www.nature.com/articles/](https://www.nature.com/articles/nclimate3252)
859 [nclimate3252](https://www.nature.com/articles/nclimate3252), doi:10.1038/nclimate3252. number: 5 Publisher: Nature Publishing
860 Group.
- 861 Howe, D., Cox, R.J., 2018a. Guidelines for seawall adaptation Science and Synthesis for
862 NSW. Technical Report 264. Water Research Laboratory. New South Wales, Australia.

- Howe, D., Cox, R.J., 2018b. Upgrading Breakwaters in Response to Sea Level Rise: Practical Insights from Physical Modelling. Coastal Engineering Proceedings , 35–35 URL: <https://icce-ojs-tamu.tdl.org/icce/index.php/icce/article/view/8531>, doi:10.9753/icce.v36.structures.35.
- Jennings, R., Shulmeister, J., 2002. A field based classification scheme for gravel beaches. Marine Geology 186, 211–228. URL: <http://www.sciencedirect.com/science/article/pii/S0025322702003146>, doi:10.1016/S0025-3227(02)00314-6.
- Kana, T.W., Kaczowski, H.L., Traynum, S.B., 2018. Five Key Elements for a Sustainable Nourishment Program. Coastal Engineering Proceedings , 17–17 doi:10.9753/icce.v36.risk.17. number: 36.
- Komar, P.D., Allan, J.C., 2010. “Design with Nature” Strategies for Shore Protection: The Construction of a Cobble Berm and Artificial Dune in an Oregon State Park, in: Proceedings of a State of the Science Workshop, p. 10.
- Ludka, B.C., Guza, R.T., O’Reilly, W.C., 2018. Nourishment evolution and impacts at four southern California beaches: A sand volume analysis. Coastal Engineering 136, 96–105. URL: <http://www.sciencedirect.com/science/article/pii/S0378383917303150>, doi:10.1016/j.coastaleng.2018.02.003.
- Mason, T., Coates, T.T., 2001. Sediment Transport Processes on Mixed Beaches: A Review for Shoreline Management. Journal of Coastal Research 17, 645–657. URL: <https://www.jstor.org/stable/4300216>. publisher: Coastal Education & Research Foundation, Inc.
- Matsumoto, H., Young, A.P., 2018. Automated Cobble Mapping of a Mixed Sand-Cobble Beach Using a Mobile LiDAR System. Remote Sensing 10, 1253. URL: <https://www.mdpi.com/2072-4292/10/8/1253>, doi:10.3390/rs10081253. number: 8 Publisher: Multidisciplinary Digital Publishing Institute.
- Matsumoto, H., Young, A.P., Guza, R.T., 2020a. Cusp and Mega Cusp Observations on a Mixed Sediment Beach. Earth and Space Science 7, e2020EA001366. URL: <https://agupubs.onlinelibrary.wiley.com/doi/abs/10.1029/2020EA001366>, doi:<https://doi.org/10.1029/2020EA001366>. eprint: <https://agupubs.onlinelibrary.wiley.com/doi/pdf/10.1029/2020EA001366>.
- Matsumoto, H., Young, A.P., Guza, R.T., 2020b. Observations of surface cobbles at two southern California beaches. Marine Geology 419, 106049. URL: <http://www.sciencedirect.com/science/article/pii/S0025322719301963>, doi:10.1016/j.margeo.2019.106049.
- McCall, R.T., Rijper, H., Blenkinsopp, C.E., 2019. Towards The Development of A Morphological Model for Composite Sand-Gravel Beaches. Coastal Sediments , 1889–1900 URL: https://www.worldscientific.com/doi/abs/10.1142/9789811204487_0163, doi:10.1142/9789811204487_0163.
- van der Meer, J.W., 1988. Rock slopes and gravel beaches under wave attack. Ph.D. thesis. Delft Hydraulics Laboratory. Delft, Netherlands. URL: <https://repository.tudelft.nl/islandora/object/uuid%3A67e5692c-0905-4ddd-8487-37fdda9af6b4>.

- 905 Morris, R.L., Konlechner, T.M., Ghisalberti, M., Swearer, S.E., 2018. From grey
906 to green: Efficacy of eco-engineering solutions for nature-based coastal de-
907 fence. *Global Change Biology* 24, 1827–1842. URL: <https://onlinelibrary.wiley.com/doi/abs/10.1111/gcb.14063>, doi:10.1111/gcb.14063. eprint:
908 <https://onlinelibrary.wiley.com/doi/pdf/10.1111/gcb.14063>.
909
- 910 Phipps, J.B., Smith, J.M., 1978. Coastal accretion and erosion in southwest Washington
911 .
- 912 Poate, T.G., McCall, R.T., Masselink, G., 2016. A new parameterisation for runup on
913 gravel beaches. *Coastal Engineering* 117, 176–190. URL: <http://www.sciencedirect.com/science/article/pii/S0378383916301697>, doi:10.1016/j.coastaleng.2016.
914 08.003.
915
- 916 Pranzini, E., 2018. Shore protection in Italy: From hard to soft engineering
917 ... and back. *Ocean & Coastal Management* 156, 43–57. URL: <http://www.sciencedirect.com/science/article/pii/S0964569117300753>, doi:10.1016/
918 j.ocecoaman.2017.04.018.
919
- 920 Pye, K., Blott, S.J., 2018. Advice on Sustainable Management of Coastal Shingle Re-
921 sources. Technical Report 273. Natural Resources Wales. NRW, Cardiff.
- 922 Seymour, R.J., Bockstael, N.E., Campbell, T.J., Dean, R.G., Komar, P.D., Pilkey, O.H.,
923 Pratt, A.P., Snow, M.R., Van Dolah, R.F., Weggel, J.R., 1996. Beach nourishment and
924 protection. *Shore and Beach* 64, 5–10.
- 925 Weiner, H.M., Kaminsky, G.M., Hacking, A., McCandless, D., 2019. North Cove Dynamic
926 Revetment Monitoring: Winter 2018-2019. Technical Report 19-06-008. Department
927 of Ecology. Washington State. URL: <https://fortress.wa.gov/ecy/publications/SummaryPages/1906008.html>.
928